

## Electronic Report Transmittal Form

Attention:

Discharger: Wild Wings County Service Area  
Name of Facility: Wild Wings Water Recycling Facility  
WDRs Order Number: R5-2002-0077  
CIWQS Place 1D: 272537  
County: Yolo

I am hereby submitting to the Central Valley Water Board the following information:

**Check all that apply:**

Technical Report Title and Date \_\_\_\_\_

Monthly Monitoring Report for the month of \_\_\_\_\_

1st/2nd/ 3rd / 4th (circle one) Quarterly Monitoring Report for the year of \_\_\_\_\_

1st/ 2nd (circle one) Semi-annual Monitoring Report for the year \_\_\_\_\_

Annual Monitoring Report for the year N/A \_\_\_\_\_

**Violation Notification:**

During the monitoring period, therewere / were not (circle one) any violations of the WDRs

1. The violations were:

2. Have the violations been corrected? Yes / No. If no, what will be done to correct the violations:

**Certification Statement:**

*"I certify under penalty of law that I have personally examined and am familiar with the Information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe that the information is true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment."*

Signature:  Phone: (916) 616-7761

Printed Name: Dan DeMoss Date: 8-28-2019

**Wild Wings Water Recycling Facility – Second Quarter 2019  
Groundwater Monitoring Report  
WDR Order No. R5-2002-0077**

Prepared for:

Yolo County, California



August 2019

Prepared by:

California Rural Water Association





# California

Rural Water Association

August 28, 2019

Ms. Beth Gabor  
Yolo County  
625 Court Street,  
Room 202  
Woodland, CA 95695

VIA Email.

**Re: Groundwater Monitoring Report Second Quarter 2019  
Wild Wings Water Recycling Facility, Yolo County, CA WDR No. R5-2002-0077**

Dear Ms. Gabor:

California Rural Water Association is pleased to present this report as a summary of the Groundwater Monitoring Data from the Second Quarter of 2019.


If you have any questions regarding this report, please call our Senior Hydrogeologist, Thomas Ballard, CHG, at (916) 761-3700 or Dan DeMoss at (916) 553-4900.

Sincerely,  
California Rural Water Association

Dan DeMoss  
Executive Director

A handwritten signature in blue ink that reads "Thomas E. Ballard".

Thomas Ballard  
Senior Hydrogeologist

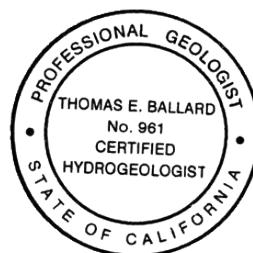

## TABLE OF CONTENTS

1.0	Introduction .....	1
1.1	Location.....	1
1.2	Site Information .....	1
1.3	Monitoring Wells.....	2
1.4	Sampling Pump Details.....	2
1.5	Historic Monitoring Results.....	3
1.6	Groundwater Quality Limitations.....	4
2.0	Groundwater Monitoring .....	5
2.1	Groundwater Levels .....	6
2.2	Pre-Sampling Activities.....	6
2.3	Groundwater Sampling .....	6
2.4	Groundwater Levels and Flow Direction .....	7
3.0	Findings .....	7
3.1	Groundwater Levels .....	7
3.2	Groundwater Flow Direction and Gradient.....	8
3.3	Groundwater Quality .....	8
3.4	Comparison to Interim Groundwater Limitations.....	9
4.0	Conclusions .....	10

## FIGURES

Figure 1 – Site and Vicinity Map

Figure 2 – Groundwater Contours-February 2019

## TABLES

Table 1 – Monitoring Well Construction Details

Table 2 – Static Water Level Measurements in Monitoring Wells

Table 3 – Groundwater Flow Direction and Gradient

Table 4 – Groundwater Quality Monitoring Results

Table 5 – Quality Assurance/Quality Control Samples

## CHARTS

Chart 1 – Historical Static Water Trends

Chart 2 – Historical pH Trends

Chart 3 – Historical Total Dissolved Solids Trends

Chart 4 – Historical Sodium Trends

Chart 5 – Historical Chloride Trends

Chart 6 – Historical Boron Trends

Chart 7 – Historical Nitrate (as Nitrogen) Trends

Chart 8 – Historical Total Nitrogen Trends

**APPENDIX A – Field Data Forms**

**APPENDIX B – Laboratory Analytical Results & Chain of Custody**

## 1.0 INTRODUCTION

California Rural Water Association (CRWA) prepared this groundwater monitoring report on behalf of Yolo County for the Wild Wings Water Recycling Facility (WWRF) at the Wild Wings residential development, in Yolo County, California. This report represents and summarizes data collected and analyzed by CRWA, in conjunction with contract laboratory work, in June 2019; and also includes historical data and information from previous reports, consultants and laboratories.

Yolo County requested that CRWA provide groundwater monitoring and reporting for the WWRF to comply with Regional Water Quality Control Board (RWQCB) Waste Discharge Requirements (WDR) Order R5-2002-0077. The WDR requires quarterly monitoring and reporting of the groundwater levels and quality at the monitoring wells. National, under contract with Yolo County, began operating the WWRF on April 1, 2016. CRWA performed the field sampling and monitoring at the site on June 18, 2019.

### 1.1 LOCATION

The Wild Wings development is located north of Highway 16 and west of County Road 94B at 18530 Wildwings Drive, Woodland, CA 95695, and is surrounded by agricultural land to the west, Cache Creek and the Yolo Fliers Golf Club to the north, the Watts-Woodland Airport to the east, and several rural residences to the south. In early 2015, almond orchards were planted in the agricultural land to the west of the site and water wells were installed to provide water for the orchards. The WWRF encompasses 3.67 acres (400 by 400 feet) along the southwestern side of the Wild Wings development. Figure 1 shows the location of the WWRF along with general site information and locations of seven (7) monitoring wells.

### 1.2 SITE INFORMATION

The Wild Wings development consists of over 300 homes, a nine-hole golf course (including several ponds/lakes), and the WWRF, all built on 238 acres of previously undeveloped land. The WWRF has been operating since February 2005. Domestic wastewater from the Wild Wings development is treated to a tertiary level at the WWRF. The treated water is then blended with groundwater obtained from two deep on-site water supply wells and is used for irrigation of the golf course. The mixture of applied irrigation water typically consists of approximately one-fourth recycled water, but this ratio will vary by month. When irrigation demands are reduced, a lined storage pond on the WWRF site stores the recycled water. National does not operate or maintain the golf course irrigation system or ponds on the golf course.

### 1.3 MONITORING WELLS

Seven monitoring wells, MW-1 through MW-7, were constructed in May through June 2004. The monitoring wells were installed on the Wild Wings development in the vicinity of the WWRF. The locations of the monitoring wells are shown on Figure 1.

The WDR required that the monitoring wells be constructed to monitor the uppermost aquifer. While drilling, soil samples were collected to assess the subsurface lithology and to locate the uppermost aquifer. Review of the well logs shows that clays with various amounts of silt, sand, and gravel are predominant at the site. However, beds of coarse-grained materials, sands and gravels, with trace amounts of silt and clay were also logged at all monitoring well sites.

The monitoring wells were completed to depths ranging from 31 to 74 feet below ground surface (bgs). Each well is constructed with 2-inch schedule 40 PVC well casing and screen. The screen intervals are 10 feet in length at most wells, with the exception of MW-4 and MW-5R, which have 15-foot and 20-foot screen intervals, respectively. The top of each well casing is fitted with an expandable plug to prevent surface water from entering the wells. The top of each well is secured in a subsurface vault. Table 1 summarizes the well construction details. The well screens are not at the same depth in all of the monitoring wells. The depths varied based on when groundwater was first encountered. Thick clay beds were encountered at MW-4 and MW-5R and continued to relatively deep depths. MW-4 and MW-5R have deeper screen intervals than the other monitoring wells, ranging from an elevation of 51 to 71 feet mean sea level (msl). In contrast, MW-1, MW-2, MW-6, and MW-7 are screened at shallower depths, between 73 to 95 feet msl. MW-3 has the shallowest screen interval ranging from an elevation of 90 to 100 feet msl.

The lithologic sequences of strata encountered during well drilling show a heterogeneous appearance across the site making lateral geologic correlation difficult on a site scale (Luhdorff and Scalmanini, 2006). Furthermore, the uppermost water-bearing zone in which all monitoring wells are screened has weak to no lateral continuity across the site based on the lithologic logs. Based on evaluation of the lithology and well construction details, the consistent anomalously high groundwater elevations, and analytical results from previous monitoring reports, MW-3 appears to be screened in a perched water zone and not within the unconfined to semi-confined aquifers in which the other monitoring wells are screened. Therefore, groundwater in MW-3 does not appear to be in direct hydraulic communication with the other network wells.

### 1.4. SAMPLING PUMP DETAILS

Sampling and purging of the monitoring wells is accomplished with the use of a low flow electric submersible pump powered by portable battery system. Plastic tubing, which is disinfected prior to purging, between purging and sampling and after sampling, is used to conduct both the purging of the well and collection of groundwater samples. The pump is portable and is transported between wells.

## 1.5 HISTORIC MONITORING RESULTS

The WWRF has been active since February 2005. The WDR required that three monitoring events take place prior to the startup of the WWRF; however, only one monitoring event was performed. Quarterly monitoring commenced in March 2005. Historic monitoring results are summarized below:

- Groundwater levels have ranged from 19.7 to 56.7 feet below top of casing (btoc) or 64.0 to 101.7 feet mean sea level (msl). Groundwater has consistently been the shallowest at MW-3 and the deepest at MW-4. Since the fourth quarter 2008 MW-7 has been dry about 75 percent of the sampling events and has been dry from the third quarter 2013 until the first quarter of 2017 – corresponding to the California regional drought conditions. Table 2 summarizes the historic groundwater levels and Figure 2 displays a line graph of these historical groundwater levels.
- Groundwater flow direction has been consistently towards the northeast to east-northeast. Using MW-1, MW-4, and MW-5R to determine flow direction and gradient, the flow direction has varied from 53.3 to 75.0 degrees and the groundwater gradient has ranged from 0.005 to 0.009 ft./ft. The gradient has gradually steepened and the flow direction has changed to a more easterly direction since monitoring started in 2005. The most recent monitoring event in February 2018 indicates a 3-point gradient of 0.006 ft./ft. and a direction of 72 degrees. Table 3 summarizes historic groundwater flow directions and gradients.
- MW-1 has been consistently up-gradient of the recycled water effluent pond, whereas MW-4, MW-6, and MW-7 have consistently been down-gradient of the recycled water effluent pond. MW-2 is located adjacent to the recycled water effluent pond. MW-5R appears to be an up-gradient well that is recharged from Cache Creek, but is slightly down-gradient to the recycled water effluent pond.
- MW-3 has consistently had higher groundwater surface elevations than the other monitoring wells. Because of this, supplemented by the shallow screen interval, poor recharge, persistent presence of total coliform organisms as well as an overall different water quality than the other wells, and often gray to tan color of the water, MW-3 appears to be screened in a perched water zone. This perched or mounded water table appears prominently in the August 2017 data – but the November 2017 data did not look as pronounced.
- The WDR requires that monitoring wells be sampled and analyzed for the following constituents: pH, total dissolved solids (TDS), sodium, chloride, boron, iron, manganese, nitrate (as nitrogen), nitrite (as nitrogen), ammonia (as nitrogen), total nitrogen, total coliform organisms, and total trihalomethanes (TTHMs). In addition to the WDR requirements, samples collected up to February 2008 were analyzed for fecal coliform. Historical monitoring results are summarized in Table 4. Figures 3 through 9 show concentration trend graphs for the monitoring parameters.

- Metals analyses are required from the monitoring wells. Sampling protocol requires that the turbidity be below 5 Nephelometric Units (NTU) when collecting water samples for metal analyses, otherwise the sample must be filtered prior to being collected and reported as dissolved metals. Due to historical issues with turbidity and purging, the sampling protocol for Q4 2017 was adopted to field filter and continued for Q1 of 2018.
- Total coliform organisms have been sporadically detected at all wells since monitoring commenced. They have been most consistently detected at MW-3, which also has had positive results for fecal bacteria; however, since the second quarter 2013, total coliform organisms at MW-3 have only been detected four times. MW-3 has had past worm-like organisms and has been treated with disinfection products. Recently, no organisms have been visible and the Q3 sampling event had no detections for disinfection by-products, as analyzed for TTHM's.
- Groundwater quality samples were not obtained from MW-7 between November 2006 and November 2016, except for May and August 2011, due to either the well being dry or an insufficient amount of water in the well to collect samples. Since the wet weather in winter 2016 -2017, sufficient amounts of sample water from MW-7 have been retrieved for laboratory analyses – Until November 2017. In November 2017, there was not sufficient water to purge in MW-7 to collect samples and perform laboratory analyses. Again, in February 2018, there was insufficient water in MW-7 for sample collection.
- Groundwater quality analytical results were not available for the fourth quarter 2006 (except for total coliform results), first quarter 2007, and first quarter 2008.
- MW-2 has had historical security issues related to soils and foreign water entering the well vault. Previous reports contain details of this issue.

## 1.6 GROUNDWATER QUALITY LIMITATIONS

### Interim Groundwater Limitations

Borings HB-2, HB-3, HB-7, and B-27 were drilled prior to the startup of the WWRF and within the vicinity of the WWRF. Water samples collected from these borings were used as the background water quality, using the average value for each constituent. Interim groundwater limitations for the WWRF were developed by comparing the basin plan Water Quality Objectives (WQOs) and background water quality data and using the highest value as the interim groundwater limitation. The interim groundwater limitations are listed at the top of Table 4.

The following summarizes how the WWRF monitoring wells have historically compared to the interim groundwater limitations:

- Boron has exceeded the interim groundwater limitations at all wells since quarterly monitoring commenced. Down-gradient monitoring wells MW-2 and MW-6 have had higher concentrations than up-gradient well MW-1.
- Up-gradient MW-1 is typically at or exceeding the interim groundwater limitations for TDS, chloride, nitrate (as nitrogen), and total nitrogen. Historically the TDS, chloride, nitrate (as nitrogen) and total nitrogen results are higher at MW-1 than at any other well in the monitoring well network. However, since 2013 chloride has been highest at down-gradient well MW-4. Nitrate concentrations have been variable and now (Q3 of 2018) several wells exceed the nitrate levels in MW-1.
- MW-2, the closest well to the WWRF, regularly exceeded the interim groundwater limitations for total nitrogen prior to 2008, from 2008 through 2016 total nitrogen has been less than the interim limitations. But since 2017, is again above the interim limit. For Q1 2018, MW-2 depicts higher nitrate and total nitrogen than the recent past. Prior to the fourth quarter 2013 the interim groundwater limitations were occasionally exceeded for sodium at MW-2, but since this time they have been below the interim groundwater limitations, until June 2017 when they again were slightly above the interim limit. Sodium in MW-2 has declined in recent sampling events but remains barely above the interim standard. Chloride levels at MW-2 exceeded the interim groundwater limitations from the fourth quarter 2010 through the first quarter 2012, but since this time the levels have been less than the interim limitations.
- Quarterly monitoring results at cross-gradient MW-5R and down-gradient MW-4, MW-6, and MW-7 have rarely exceeded the interim groundwater limitations for any constituent, with the exception of chloride and total nitrogen at MW-4 and sodium at MW-6 (with some exceptions).

### **Final Groundwater Limitations**

On January 8, 2008, the RWQCB requested Yolo County prepare a Background Groundwater Quality Study/Groundwater Degradation Assessment Report to establish statistically derived water quality limitations. Central Valley Environmental, Incorporated (CVEI) prepared a Background Groundwater Quality Study/Groundwater Degradation Assessment Report dated April 1, 2009. Yolo County submitted the report to the RWQCB. CVEI used statistical methods to derive tolerance intervals representing the 95<sup>th</sup> quantile of all water quality sampling results from 2004 through February 2009. CVEI used these values in conjunction with the WQOs, using the greater of the two, to recommend Final Groundwater Limitations. Approval of the Final Groundwater Limitations by the RWQCB is still pending. However, since 2009 the sample population has more than doubled and therefore the analyses may be outdated.

## **2.0 GROUNDWATER MONITORING**

Groundwater monitoring was performed on June 18, 2019 by CRWA personnel experienced with groundwater sampling. The following sections describe the monitoring protocol used to

measure the depth to water, purge the wells, and collect water quality samples from the monitoring wells.

## 2.1 GROUNDWATER LEVELS

CRWA personnel measured the depth to groundwater at the monitoring wells using an electric water level sounder accurate to 0.01 foot. The sounder was cleaned and decontaminated prior to the first monitoring well measurement and between each well site by thoroughly washing and scrubbing the sounding probe and line with a laboratory-grade detergent (Alconox) and distilled water, followed by a triple rinse with distilled water. The sounding probe and line was then sprayed with a 10 percent bleach solution to kill any bacteria. The sounding probe was allowed to air dry between wells.

## 2.2 PRE-SAMPLING ACTIVITIES

After the depth to groundwater was measured at a monitoring well, the well was purged. Each monitoring well was purged through the use of a portable low flow submersible pump. Prior to purging, the top 6 inches of the polyethylene tubing was decontaminated. The polyethylene tube was then connected to a vinyl tube via a double-barbed nipple and the vinyl tubing was routed to an empty 5-gallon bucket. The double-barbed nipple and vinyl tubing were cleaned and decontaminated prior to initial use and between each well (primary disinfection). The procedures for cleaning and decontaminating are the same as listed above (Groundwater Levels) except the vinyl tubing received six rinses with distilled water after cleaning.

Prior to collecting the groundwater samples, each monitoring well was micro purged (verbal approval, RWQCB 2008). Micro purging consisted of pumping each well until field parameters such as pH, temperature, and EC stabilized. Field parameters were measured by collecting purge water from the discharge line at select intervals and using a calibrated multi-parameter meter to record the readings. The volume purged and field parameters are documented on field data sheets, which are presented in Appendix A. The purge water was collected in 5-gallon buckets and then transported back to the WWRF and discharged to the wastewater holding tanks.

## 2.3 GROUNDWATER SAMPLING

Once each monitoring well was purged, CRWA personnel collected water samples in laboratory-prepared bottles. Prior to collecting the first sample, the vinyl tube connected to the 5-gallon bucket was disconnected from the bucket and the tip was sprayed with a 10 percent bleach solution to kill any bacteria that may have been present in the bucket and inadvertently transferred to the sampling tube (secondary disinfection). To eliminate any residual chlorine, pumping was then resumed for about 30 to 60 seconds (approximately 0.25 to 0.5 gallons) and the end of the vinyl tube was elevated and pinched so that the entire tubing surface was in contact with the purge water prior to sampling. The bacteriological (total coliform) sample was the first sample collected and was collected directly from the end of the vinyl tube, followed by

collection of samples for THMs. The samples for all other constituents analyzed were collected next. Water samples for metals were filtered in the field using a disposable 0.45 micron filter before being placed into acidified laboratory prepared sample bottles. Trip blanks are included by CLS for TTHM's analysis, when requested.

Nitrile gloves were worn while collecting samples. A new set of gloves was used at every monitoring well. The samples were placed in an ice chest and cooled to 4 degrees Celsius and delivered to California Laboratory Services (CLS) of Rancho Cordova, California, a California-certified laboratory, under standard chain-of-custody procedures. Samples collected from the monitoring wells were analyzed for TDS, sodium, boron, iron, manganese, nitrate (as N), nitrite (as N), ammonia (as N), total N, total coliform organisms, and total trihalomethanes per the WDR requirements. Table 4 presents the results for the monitoring wells and Table 5 presents the results for any trip blank and equipment blank samples. Appendix B contains the laboratory data sheets and chain-of-custody forms.

## 2.4 GROUNDWATER LEVELS AND FLOW DIRECTION

The measured groundwater levels in each well were subtracted from the surveyed ground surface elevation at each well. Table 2 lists the elevation of the top of the well casing (TOC) (reference point) at each well and presents the current and historic depths-to-water and groundwater surface elevations. The groundwater surface elevations were used to generate groundwater contours from which the groundwater gradient was calculated. Figure 10 shows the groundwater contours and flow direction for June 2019. Groundwater gradients and flow directions were estimated using wells MW-1, MW-4, and MW-5R. Table 3 summarizes these estimates.

## 3.0 FINDINGS

### 3.1 GROUNDWATER LEVELS

Groundwater elevations in June 2019 (Second Quarter 2019) ranged from 76.31 feet msl in MW-4 to 99.90 feet msl in MW-3, and were within historic ranges. Monitoring wells MW-4 and MW-5R showed the greatest changes in groundwater levels this quarter, with water levels in MW-3 actually declining. This transition from the winter into spring trend continues and is fairly consistent within the monitoring well network. Table 2 lists the water level measurements. Chart 1 shows the current and historic groundwater levels.

Due to MW-3 being screened within a perched water zone it was left out of groundwater contouring, flow direction, and gradient calculations.

Between the First Quarter of 2019 and Second Quarter of 2019, groundwater levels rose an average of 1.64 feet. This matches what is commonly understood to be seasonal variations with moving from a relatively dry fall into a somewhat wetter winter season. Looking at the generalized pattern of rainfall and groundwater levels in the area since fall 2016 the trends in

those two parameters tend to correlate. There is generally a strong correlation between precipitation/recharge with water levels in the shallow groundwater zone.

### 3.2 GROUNDWATER FLOW DIRECTION AND GRADIENT

The groundwater flow direction and gradient for June 2019 were calculated using wells MW-1, MW-4, and MW-5R, which is consistent with past practice and historically reported data. Using these wells, the groundwater flow direction was to the east (90.3 degrees) with a gradient of 0.006 feet/feet. The groundwater gradient is generally consistent with historic results, but flow direction is more to the east than normal. Figure 2 displays the groundwater surface elevations at each well, the groundwater contours, and flow direction. In the northern portion of the site the groundwater flow direction appears to be influenced by Cache Creek. Table 3 lists the historic and current groundwater flow directions and gradients.

### 3.3 GROUNDWATER QUALITY

Tables 4 and 5 summarize the analytical results in table format and Charts 2 through 8 show the historical water quality parameter concentrations in graphical format.

Current (Second Quarter 2019) water quality results were compared to historic water quality results to assess potential increasing trends. Overall, the water quality analytical testing results for the Second Quarter of 2019 were within historical ranges and trends. While nitrates and total nitrogen showed a slight increase in concentrations MW-2 after the first quarter 2017, these concentrations have generally stabilized and are declining back towards historic levels. Concentrations for boron and TDS have remained consistent during the past 7 quarters, with TDS being generally consistent with prior quarter results in most of the wells this quarter. pH levels this quarter are consistent with historical ranges, although samples for pH were received by the laboratory slightly out of hold time. Boron and sodium are generally consistent with past analytical data. Nitrogen and nitrate levels showed an overall slight decline. Overall TDS levels appear very close to historical levels and ranges at each well, but are generally consistent with prior quarter data. The spatial variation of TDS, nitrate and boron concentrations over the recent past are best explained by the recent rainfall/dryness patterns, recharge and pumping changes in the area groundwater. Total coliform was only detected in MW-3 this quarter. Chloride samples are generally consistent with previous quarter results with MW-4 and MW-6 showing the highest results. No other significant trends in groundwater quality trends were observed from these monitoring results.

MW-3 has been an outlier in water quality with results that are significantly different from the remaining monitoring wells, and this quarter showed decreases in TDS, sodium, boron and nitrates, with a decline in chloride.

Historically, up-gradient MW-1 has had the highest concentrations of TDS, chloride, nitrate (as N), and total nitrogen, however this quarter it is lower in chloride concentrations than MW-4 and MW-6 (Second Quarter 2019).

Recently, increases in water quality parameters at MW-2 have caused it to tend to match or exceed the historic pattern of MW-1 (up gradient) being the location of the highest TDS, chloride and sodium concentrations in groundwater. For the Second Quarter 2019, this trend did not hold with all parameters except Total Nitrogen within normal ranges.

The highest nitrate (as N) (14 mg/L) and the highest total N (14 mg/L) were detected in the sample from MW-4. The sample from MW-2 again had the highest boron (5.9 mg/L) concentration detected, also consistent with historic results and mirroring the recent trend of all boron levels being elevated.

For Second Quarter 2019 sampling, total coliform was only detected in the sample from samples from MW-3. Stricter handling requirements were implemented this quarter to reduce the likelihood of cross contamination.

Ammonia (as N) was not detected at measurable concentrations in any of the wells sampled this quarter. Ammonia (as N) is not typically detected at any of the wells in the monitoring network, aside from MW-3.

Iron was reported in samples from MW-3, MW-5R, and MW-7 for the Second Quarter 2019, with no other samples detecting iron. MW-1 has had intermittent iron detections in the past. Manganese was detected in samples from MW-3 and MW-7 this quarter.

TTHMs were detected at 1.8 ug/L in the sample from MW-5R this quarter. In the sample from MW-5R, the TTHM consisted of Chloroform. A trip blank was submitted this quarter, and reported TTHM at less than the detection limit. The detected concentration of TTHM in the sample from MW-5R is consistent with intermittent recent detections and does not appear to indicate a major concern.

### 3.4 COMPARISON TO INTERIM GROUNDWATER LIMITATIONS

The water quality results from the Second Quarter 2019 monitoring event show that every monitoring well sampled exceeded the interim groundwater limitation for boron except for one, consistent with historic results.

Based on the understanding that the interim groundwater quality limits remain the higher of the background level for the site and the basin wide WQO (water quality objective), the following is a summary of each wells exceedances for the current quarter (First Quarter 2019) for other general mineral analytes (excluding boron). Comparing to the previous quarter, the number of parameters in exceedance is less.

MW-1: None

MW-2: Total Nitrogen

MW-3: Iron, Manganese, Total Coliform  
MW-4: Chloride, Total Nitrogen  
MW-5R: Iron, TTHM  
MW-6: Chloride  
MW-7: Iron, Manganese

#### 4.0 CONCLUSIONS

The groundwater contours and flow directions show there are two potential sources of groundwater to the area. MW-5R monitors water entering the area that is recharged by Cache Creek, north of the WWRF area. Water also enters the area from the south near MW- 1 and MW-2 from regions used for agriculture. MW-4, MW-6, and MW-7 are in a mixing zone between these water sources and as such minor shifts in groundwater gradients may result in a change in water quality that reflects these two different water sources. In 2015, almond orchards were planted in the fields just west of the monitoring area and water wells were installed to provide water for the orchards. Deep percolation from irrigation or pumping for water supply could affect groundwater levels and flow directions, but to date they do not appear to be affecting groundwater beneath the WWRF area. In past monitoring events, it appeared groundwater pumping east of the monitoring well network was affecting MW-4 and could be affecting MW-7.

In general, the annual rainfall amounts, irrigation practices at farm lands and golf courses, and variations in groundwater pumping to meet local domestic water needs can impact the local groundwater contours, flow direction and gradients. However, for the First Quarter 2019 monitoring event, these parameters remained within historical ranges for groundwater levels. The most recent GW contours reflect an overall increase from the First Quarter 2019 data corresponding to a wetter winter season. Generally, groundwater levels changes track each other across the various monitoring wells. GW flow gradients remain in the range of historical observations at 0.006 ft/ft for the quarter and the direction of flow is almost due east.

The analytical results from the Second Quarter 2019 sampling event show several results above the interim groundwater limitations. All wells except one exceeded the interim groundwater limitations for boron, which is consistent with historic monitoring results. Additionally, two wells had chloride levels above interim limits, several wells have total nitrogen levels slightly above the interim limits and one had Total Coliform concentrations which exceeded the interim limits. Three wells exceeded interim limits for iron and two for manganese. One well exceeded interim limits for TTHM. However, overall, the Second Quarter 2019 sample event indicated trends generally consistent with historical patterns in mineral concentrations in groundwater samples when compared to recent past quarters.

TDS concentrations were up in three wells and down in four wells this quarter, but the changes were all within historical ranges.

Overall chloride trends are consistent with prior result ranges with only MW-6 showing a notable increase.

Iron was detected in the sample from MW-3, which has had intermittent detections in the past, in the samples from MW-5R and MW-7, which have had rare detections in the past.


Manganese was detected in the sample from MW-3, which has had intermittent detections in the past and in the sample from MW-7, which has had no prior detections of manganese. Iron and manganese detections exceed interim limits by small margin.

The Second Quarter 2019 analyses for TTHMs shows that all wells except MW-1 detected TTHMs, however only MW-5R exceeded interim limits. TTHMs included chloroform, bromoform, dibromochloromethane and bromodichloromethane. This is an increase from the First Quarter 2019 where only one well had TTHM detections.

Second Quarter 2019 analyses for Total Coliform showed only one detection – a substantial change from the prior quarter where six wells had detections. Implementation of more strict sample handling protocols has reduced the likelihood of cross contamination of samples.


Review of the current quarter and historical data trends indicate the local groundwater quality appears to remain in historical ranges since before and after the operations of the WWRF.

## **FIGURES**

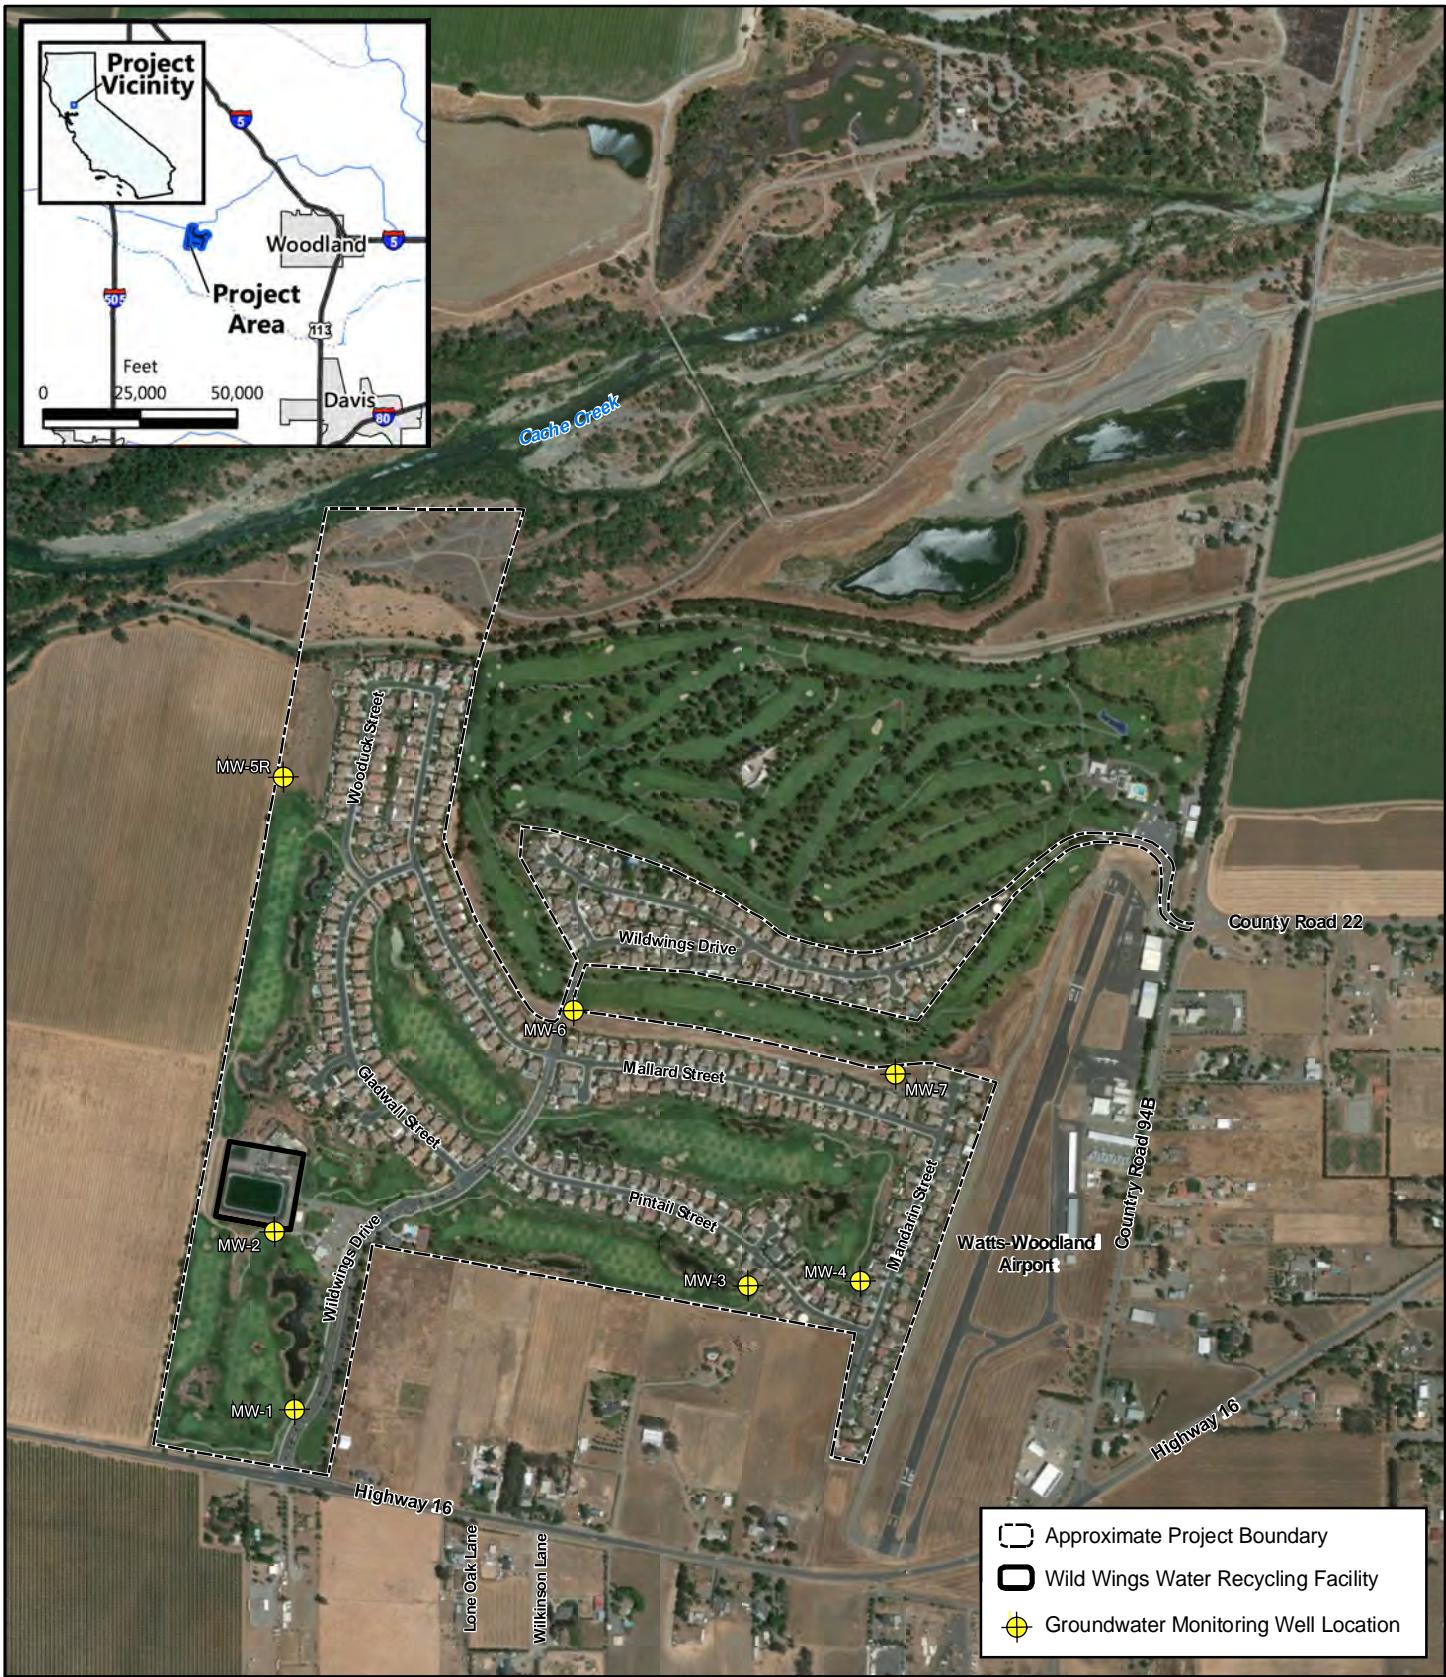

**Figure 1**  
**Site and Vicinity**

**Second Quarter 2019 Monitoring Report**  
**Wild Wings Water Recycling Facility**  
18530 Wildwings Drive  
Woodland, Yolo County, California

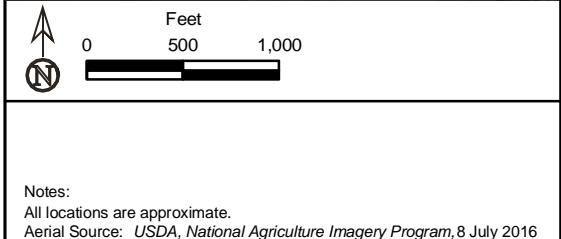



- Approximate Project Boundary
- Wild Wings Water Recycling Facility
- Groundwater Monitoring Well Location
- Groundwater Elevation Contour (ft msl)  
5 Foot Interval
- Groundwater Flow Direction

Feet  
0 500 1,000

Notes:

All locations are approximate

ft msl = feet above mean sea level

\*Groundwater monitoring well is screened at a shallower depth, therefore it is not included in groundwater elevation contouring

Aerial Source: USDA, National Agriculture Imagery Program, 8 July 2016



California  
Rural Water Association

**Figure 2**  
**Groundwater Elevation Contours**

**Second Quarter 2019 Monitoring Report**  
**Wild Wings Water Recycling Facility**  
18530 Wildwings Drive  
Woodland, Yolo County, California

## **TABLES**

**Table 1**  
**Monitoring Well Construction Details**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date Installed	Depth of Borehole (feet bgs)	Depth of Well Casing (feet bgs)	Screened Interval (feet bgs)	Slot Size (inches)	Grout (feet bgs)	Bentonite Seal (feet bgs)	Sand Pack (feet bgs)	Casing Material	TOC Elevation (feet msl)	Screen Elevations (feet msl)
MW-1	6/3/2004	46	41	31-41	0.010	0.5-25.5	25.5-28.5	28.5-45	2-inch Sch. 40 PVC, flush thread	126.22	95.22 - 85.22
MW-2	6/2/2004	51.5	47	37-47	0.010	0.5-31	31-34.5	34.5-47	2-inch Sch. 40 PVC, flush thread	124.93	87.93 - 77.93
MW-3	6/3/2004	31.5	31	21-31	0.010	0.5-14.5	14.5-19	19-32	2-inch Sch. 40 PVC, flush thread	121.37	100.37 - 90.37
MW-4	6/1/2004	71.5	70	55-70	0.010	0.5-48	48-52	52-70	2-inch Sch. 40 PVC, flush thread	120.71	65.71 - 50.71
MW-5R	6/10/2004	75	74	54-74	0.010	0.5-47	47-52	52-75	2-inch Sch. 40 PVC, flush thread	125.42	71.42 - 51.42
MW-6	5/27/2004	50	49	39-49	0.010	0.5-33	33-37	37-50	2-inch Sch. 40 PVC, flush thread	121.59	82.59 - 72.59
MW-7	5/28/2004	45	39	29-39	0.010	0.5-22	22-26.5	26.5-45	2-inch Sch. 40 PVC, flush thread	114.55	85.55 - 75.55

**Notes:**

Information for monitoring wells was extracted from Monitoring Well Installation Report (Geologic and Hydrogeologic Study) for the Wild Wings Residential Development , Jacobson Helgoth Consultants, Inc., August 2004.

All monitoring wells were drilled and constructed by PC Exploration of Rocklin, CA. An Ingersol Rand A-400 drill rig with an 8-inch diameter hollow stem auger was used. Oversight was provided by Jacobson Helgoth Consultants. Wellheads were constructed in subsurface vaults with flush mount covers and locking well caps. The top of the PVC casing is approximately 1.3 feet below ground surface (bgs).

TOC = top of casing; surveyed in reference to mean sea level by Morrow Surveying of West Sacramento, CA, on June 26, 2004

**Table 2 (MW-1)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-1	6/15/04	126.22	32.81	93.41
	3/29/05		30.62	95.6
	6/16/05		29.62	96.6
	9/29/05		31.75	94.47
	12/6/05		31.4	94.82
	2/16/06		29.99	96.23
	5/16/06		27.25	98.97
	8/21/06		29.73	96.49
	11/20/06		30.27	95.95
	2/8/07		31.37	94.85
	5/7/07		30.79	95.43
	8/29/07		32.38	93.84
	2/21/08		29.96	96.26
	5/27/08		29.7	96.52
	8/27/08		30.49	95.73
	11/24/08		32.43	93.79
	2/18/09		30.72	95.5
	5/21/09		31.28	94.94
	8/7/09		32.96	93.26
	11/5/09		34.34	91.88
	2/8/10		32.05	94.17
	5/7/10		31.85	94.37
	8/18/10		31.22	95.0
	11/2/10		32	94.22
	12/28/10		30.76	95.46
	2/23/11		31.33	94.89
	5/5/11		29.44	96.78
	8/16/11		30.23	95.99
	11/8/11		31.95	94.27
	2/27/12		32.84	93.38
	5/21/12		32.8	93.42
	8/9/12		33.84	92.38
	11/19/12		34.39	91.83
	2/21/13		32.1	94.12
	5/15/13		31.73	94.49
	8/15/13		32.84	93.38
	11/7/13		33.69	92.53
	2/25/14		34.38	91.84
	5/22/14		35.22	91.0
	8/27/14		36.65	89.57
	11/12/14		36.93	89.29
	2/26/15		34.88	91.34
	5/13/15		35.6	90.62
	8/4/15		36.03	90.19
	11/5/15		36.9	89.32
	2/4/16		35.33	90.89
	6/30/16		34.37	91.85
	8/25/16		34.59	91.63
	11/17/16		34.9	91.32
	3/7/17		26.18	100.04
	6/27/17		28.14	98.08
	8/23/17		30.09	96.13
	11/14/17		31.07	95.15
	2/21/18		32.94	93.28
	5/24/18		33.03	93.19
	9/27/18		34.07	92.15
	12/28/18		31.34	94.88
	2/28/19		28.39	97.83
	6/18/19		27.91	98.31

**Table 2 (MW-2)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-2	6/15/04	124.93	34.75	90.18
	3/29/05		33.2	91.73
	6/16/05		31.71	93.22
	9/29/05		36.67	88.26
	12/6/05		36.29	88.64
	2/16/06		31.85	93.08
	5/16/06		28.12	96.81
	8/21/06		33.17	91.76
	11/20/06		34.75	90.18
	2/8/07		34.81	90.12
	5/7/07		35.53	89.4
	8/29/07		39.92	85.01
	2/21/08		33.15	91.78
	5/27/08		34.25	90.68
	8/27/08		37.59	87.34
	11/25/08		37.3	87.63
	2/19/09		36.01	88.92
	5/21/09		36.47	88.46
	8/7/09		40.14	84.79
	11/5/09		41.38	83.55
	2/8/10		38.48	86.45
	5/7/10		35.8	89.13
	8/18/10		36.66	88.27
	11/2/10		38.25	86.68
	12/28/10		37.08	87.85
	2/23/11		35.68	89.25
	5/5/11		30.87	94.06
	8/16/11		33.73	91.2
	11/8/11		35.93	89
	2/27/12		36.04	88.89
	5/21/12		35.89	89.04
	8/9/12		37.54	87.39
	11/19/12		37.9	87.03
	2/21/13		34.6	90.33
	5/15/13		36.4	88.53
	8/15/13		38.8	86.13
	11/7/13		38.74	86.19
	2/25/14		38.78	86.15
	5/22/14		41.17	83.76
	8/27/14		dry	
	11/12/14		45.07	79.86
	2/26/15		39.83	85.1
	5/13/15		39.72	85.21
	8/4/15		39.35	85.58
	11/5/15		41.79	83.14
	2/4/16		40.41	84.52
	6/30/16		37.44	87.49
	8/25/16		38.39	86.54
	11/17/16		37.67	87.26
	3/7/17		27.4	97.53
	6/27/17		30.42	94.51
	8/23/17		33.31	91.62
	11/14/17		35.97	88.96
	2/21/18		35.87	89.06
	5/24/18		35.5	89.43
	9/27/18		37.08	87.85
	12/28/18		34.06	90.87
	2/28/19		31.39	93.54
	6/18/19		29.1	95.83

**Table 2 (MW-3)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-3	6/15/04	121.37	20.42	100.95
	3/29/05		21.33	100.04
	6/16/05		20.14	101.23
	9/29/05		22.45	98.92
	12/6/05		21.54	99.83
	2/16/06		21.65	99.72
	5/16/06		26.51	94.86
	8/21/06		21.49	99.88
	11/20/06		21.14	100.23
	2/8/07		23.02	98.35
	5/7/07		20.63	100.74
	8/29/07		22.99	98.38
	2/21/08		21.24	100.13
	5/27/08		22.19	99.18
	8/28/08		23	98.37
	11/25/08		24.39	96.98
	2/19/09		19.67	101.7
	5/21/09		21.31	100.06
	8/7/09		22.49	98.88
	11/5/09		24.29	97.08
	2/8/10		20.2	101.17
	5/7/10		23.21	98.16
	8/18/10		23.55	97.82
	11/2/10		25.13	96.24
	12/28/10		19.95	101.42
	2/23/11		20.66	100.71
	5/5/11		21.64	99.73
	8/16/11		23.3	98.07
	11/8/11		25.03	96.34
	2/27/12		24.69	96.68
	5/21/12		24.44	96.93
	8/9/12		25.58	95.79
	11/19/12		25.96	95.41
	2/21/13		24.15	97.22
	5/15/13		25.45	95.92
	8/16/13		26.67	94.7
	11/7/13		25.97	95.4
	2/25/14		25.44	95.93
	5/22/14		26.5	94.87
	8/27/14		28.75	92.62
	11/12/14		29.53	91.84
	2/26/15		21.33	100.04
	5/13/15		23.53	97.84
	8/4/15		25.7	95.67
	11/5/15		28.7	92.67
	2/4/16		24.81	96.56
	6/30/16		25.89	95.48
	8/25/16		27.74	93.63
	11/17/16		29.6	91.77
	3/7/17		19.13	102.24
	6/27/17		22.75	98.62
	8/23/17		23.33	98.04
	11/14/17		25.87	95.5
	2/21/18		26.98	94.39
	5/24/18		25.54	95.83
	9/27/18		27.37	94.0
	12/28/18		24.25	97.1
	2/28/19		16.75	104.6
	6/18/19		21.52	99.9

**Table 2 (MW-4)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-4	6/15/04	120.71	44.59	76.12
	3/29/05		42.83	77.88
	6/16/05		41.93	78.78
	9/29/05		na	
	12/6/05		46.6	74.11
	2/16/06		42.31	78.4
	5/16/06		37.61	83.1
	8/21/06		42.25	78.46
	11/20/06		41.8	78.91
	2/8/07		40.85	79.86
	5/7/07		40.92	79.79
	8/29/07		46.13	74.58
	2/21/08		41.2	79.51
	5/27/08		42.34	78.37
	8/28/08		45.65	75.06
	11/25/08		46.07	74.64
	2/19/09		45.29	75.42
	5/21/09		44.44	76.27
	8/7/09		49.54	71.17
	11/5/09		51	69.71
	2/8/10		49.31	71.4
	5/7/10		45.94	74.77
	8/18/10		48.05	72.66
	11/2/10		49.05	71.66
	12/28/10		48.01	72.7
	2/23/11		46.31	74.4
	5/5/11		42.04	78.67
	8/16/11		45.02	75.69
	11/8/11		46.64	74.07
	2/27/12		44.72	75.99
	5/21/12		44.56	76.15
	8/9/12		48.08	72.63
	11/19/12		49.78	70.93
	2/21/13		45.9	74.81
	5/15/13		46.69	74.02
	8/16/13		50.67	70.04
	11/7/13		51.99	68.72
	2/25/14		50.88	69.83
	5/22/14		51.08	69.63
	8/27/14		55.49	65.22
	11/12/14		56.36	64.35
	2/26/15		53.85	66.86
	5/13/15		53.9	66.81
	8/4/15		55.42	65.29
	11/5/15		56.74	63.97
	2/4/16		56.4	64.31
	6/30/16		54.22	66.49
	8/25/16		55.21	65.5
	11/17/16		55.54	65.17
	3/7/17		48.46	72.25
	6/27/17		47.06	73.65
	8/23/17		48.59	72.12
	11/14/17		49.98	70.73
	2/21/18		49.98	70.73
	5/24/18		49.69	71.02
	9/27/18		53.11	67.6
	12/28/18		53.42	67.29
	2/28/19		49.4	71.31
	6/18/19		44.4	76.31

**Table 2 (MW-5R)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-5R	6/15/04	125.42	39.37	86.05
	3/29/05		37.65	87.77
	6/16/05		35.62	89.8
	9/29/05		40.73	84.69
	12/6/05		40.78	84.64
	2/16/06		36.02	89.4
	5/16/06		37.05	88.37
	8/21/06		36.12	89.3
	11/20/06		38.95	86.47
	2/8/07		38.97	86.45
	5/7/07		38.42	87
	8/29/07		42.97	82.45
	2/21/08		37.5	87.92
	5/27/08		38.06	87.36
	8/27/08		41.41	84.01
	11/24/08		41.84	83.58
	2/18/09		40.73	84.69
	5/21/09		40.54	84.88
	8/7/09		43.1	82.32
	11/5/09		45.2	80.22
	2/8/10		42.4	83.02
	5/7/10		39.77	85.65
	8/18/10		40.15	85.27
	11/2/10		42.53	82.89
	12/28/10		41.53	83.89
	2/23/11		40.1	85.32
	5/5/11		34.65	90.77
	8/16/11		36.78	88.64
	11/8/11		40.14	85.28
	2/27/12		40.31	85.11
	5/21/12		38.6	86.82
	8/9/12		40.68	84.74
	11/19/12		42.11	83.31
	2/21/13		39.03	86.39
	5/15/13		39.69	85.73
	8/15/13		41.55	83.87
	11/7/13		42.43	82.99
	2/25/14		42.28	83.14
	5/22/14		44.12	81.3
	8/27/14		49.26	76.16
	11/12/14		48.34	77.08
	2/26/15		43.39	82.03
	5/13/15		43.03	82.39
	8/4/15		42.8	82.62
	11/5/15		45.3	80.12
	2/4/16		43.76	81.66
	6/30/16		41.06	84.36
	8/25/16		42.23	83.19
	11/17/16		41.53	83.89
	3/7/17		32.08	93.34
	6/27/17		34.96	90.46
	8/23/17		38.11	87.31
	11/14/17		39.69	85.73
	2/21/18		40.39	85.03
	5/24/18		38.03	87.39
	9/27/18		41.65	83.77
	12/28/18		40.7	84.72
	2/28/19		35.59	89.83
	6/18/19		31.69	93.73

**Table 2 (MW-6)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-6	6/15/04	121.59	37.96	83.63
	3/29/05		37.26	84.33
	6/16/05		34.92	86.67
	9/29/05		40.59	81
	12/6/05		40.77	80.82
	2/16/06		35.32	86.27
	5/16/06		30.28	91.31
	8/21/06		35.59	86
	11/20/06		38.57	83.02
	2/8/07		38.46	83.13
	5/7/07		37.97	83.62
	8/29/07		42.96	78.63
	2/21/08		37.02	84.57
	5/27/08		37.56	84.03
	8/27/08		41.26	80.33
	11/24/08		41.98	79.61
	2/18/09		40.67	80.92
	5/21/09		39.94	81.65
	8/7/09		42.98	78.61
	11/5/09		45.37	76.22
	2/8/10		42.51	79.08
	5/7/10		39.51	82.08
	8/18/10		40.14	81.45
	11/2/10		42	75.57
	12/28/10		41.67	79.92
	2/23/11		40.1	81.49
	5/5/11		34.03	87.56
	8/16/11		36.23	85.36
	11/8/11		40.27	81.32
	2/27/12		40.2	81.39
	5/21/12		38.67	82.92
	8/9/12		41.03	80.56
	11/19/12		42.47	79.12
	2/21/13		38.91	82.68
	5/15/13		39.64	81.95
	8/15/13		41.84	79.75
	11/7/13		42.65	78.94
	2/25/14		42.34	79.25
	5/22/14		44.14	77.45
	8/27/14		dry	
	11/12/14		dry	
	2/26/15		43.62	77.97
	5/13/15		43.65	77.94
	8/4/15		43.2	78.39
	11/5/15		45.58	76.01
	2/4/16		43.92	77.67
	6/30/16		41.31	80.28
	8/25/16		42.62	78.97
	11/17/16		41.8	79.79
	3/7/17		31.88	89.71
	6/27/17		34.37	87.22
	8/23/17		37.96	83.63
	11/14/17		39.71	81.88
	2/21/18		40.15	81.44
	5/24/18		39.25	82.34
	9/27/18		41.78	79.81
	12/28/18		40.71	80.88
	2/28/19		35.6	85.99
	6/18/19		32.69	88.9

**Table 2 (MW-7)**  
**Static Water Level Measurement in Monitoring Wells**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Well	Date	TOC Elevation (feet msl)	DTW (feet btoc)	Water Surface Elevation (feet msl)
MW-7	6/15/2004	114.55	36.22	78.33
	3/29/2005		35.8	78.75
	6/16/2005		33.77	80.78
	9/29/2005		38.09	76.46
	12/6/2005		dry	
	2/16/2006		34.08	80.47
	5/16/2006		28.69	85.86
	8/21/2006		34.29	80.26
	11/20/2006		36.96	77.59
	2/8/2007		36.85	77.7
	5/7/2007		36.22	78.33
	8/29/2007		dry	
	2/21/2008		35.55	79
	5/27/2008		35.92	78.63
	8/27/2008		38.16	76.39
	11/24/2008		dry	
	2/18/2009		dry	
	5/21/2009		dry	
	8/7/2009		dry	
	11/5/2009		dry	
	2/8/2010		dry	
	5/7/2010		37.4	77.15
	8/18/2010		dry	
	11/2/2010		dry	
	12/28/2010		dry	
	2/23/2011		37.95	76.6
	5/5/2011		33.15	81.4
	8/16/2011		34.92	79.63
	11/8/2011		dry	
	2/27/2012		38.04	76.51
	5/21/2012		36.95	77.6
	8/9/2012		dry	
	11/19/2012		dry	
	2/21/2013		37.21	77.34
	5/15/2013		37.55	77
	8/15/2013		dry	
	11/7/2013		dry	
	2/25/2014		dry	
	5/22/2014		dry	
	8/27/2014		dry	
	11/12/2010		dry	
	2/26/2015		dry	
	5/13/2015		dry	
	8/4/2015		dry	
	11/5/2015		dry	
	2/4/2016		dry	
	6/30/2016		dry	
	8/25/2016		dry	
	11/17/2016		dry	
	3/7/2017		32.01	82.54
	6/27/2017		33.57	80.98
	8/23/2017		36.69	77.86
	11/14/2017		38.26	76.29
	2/21/18		38.42	76.13
	5/24/18		39.35	75.20
	9/27/18		dry	
	12/28/18		dry	
	2/28/19		34.9	79.65
	6/18/19		31.85	82.70

**Table 3**  
**Groundwater Flow Direction and Gradient**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Sample Date	Water Surface Elevation <sup>1</sup> MW-1 MW-5R MW-4			Gradient (ft/ft)	Flow Direction (degrees) <sup>2</sup>
6/15/2004	93.41	86.05	76.12	0.006	65
3/29/2005	95.6	87.77	77.88	0.006	64.2
6/16/2005	96.6	89.8	78.78	0.006	67.3
9/29/2005	94.47	84.69	n/a	n/a	n/a
12/6/2005	94.82	84.64	74.11	0.007	61.7
2/16/2006	96.23	89.4	78.4	0.006	67.2
5/16/2006	98.97	88.37	83.1	0.006	53.3
8/21/2006	96.49	89.3	78.46	0.006	66.4
11/20/2006	95.95	86.47	78.91	0.006	58.5
2/8/2007	94.85	86.45	79.86	0.005	58.3
5/7/2007	95.43	87	79.79	0.005	59.4
8/29/2007	93.84	82.45	74.58	0.007	56.9
2/21/2008	96.26	87.92	79.51	0.006	61.4
5/27/2008	96.52	87.36	78.37	0.006	61.1
8/27/2008	95.73	84.01	75.06	0.007	58
11/24/2008	93.79	83.58	74.64	0.007	59.7
2/18/2009	95.5	84.69	75.42	0.007	59.4
5/21/2009	94.9	84.88	76.27	0.006	59.4
8/4/2009	93.26	82.32	71.17	0.008	61.5
11/5/2009	91.88	80.22	69.71	0.008	60
2/8/2010	94.17	83.02	71.4	0.008	61.8
5/7/2010	94.37	85.65	74.77	0.007	64
8/18/2010	95	85.27	72.66	0.008	64.5
11/2/2010	94.22	82.89	71.66	0.008	61.2
12/28/2010	95.46	83.89	72.7	0.008	60.9
2/23/2011	94.89	85.32	74.4	0.007	62.9
5/5/2011	96.78	90.77	78.67	0.006	69.9
8/16/2011	95.99	88.64	75.69	0.007	68.3
11/8/2011	94.27	85.28	74.07	0.007	64
2/27/2012	93.38	85.11	75.99	0.006	62.5
5/21/2012	93.42	86.82	76.15	0.006	67.3
8/9/2012	92.38	84.74	72.63	0.007	67
11/19/2012	91.83	83.31	70.93	0.007	65.9
2/21/2013	94.12	86.39	74.81	0.007	66.3
5/15/2013	94.49	85.73	74.02	0.007	64.9
8/15/2013	93.38	83.87	70.04	0.008	66
11/7/2013	92.53	82.99	68.72	0.008	66.3
2/25/2014	91.84	83.14	69.83	0.007	66.6
5/22/2014	91	81.3	69.63	0.007	63.6
8/27/2014	89.57	76.16	65.22	0.009	58.8
11/12/2014	89.29	77.08	64.35	0.009	61.8
2/26/2015	91.34	82.03	66.86	0.008	67.4
5/13/2015	90.62	82.39	66.81	0.008	69.2
8/4/2015	90.19	82.62	65.29	0.008	71.3
11/5/2015	89.32	80.12	63.97	0.009	68.3
2/4/2016	90.89	81.66	64.31	0.009	69.1
6/30/2016	91.85	84.36	66.49	0.009	71.8
8/25/2016	91.63	83.19	65.5	0.009	70.3
11/17/2016	91.32	83.89	65.17	0.009	72.4
3/7/2017	100.04	93.34	72.25	0.009	74.7
6/27/2017	98.08	90.46	73.66	0.008	71.0
8/23/17	96.13	87.31	72.12	0.006	74.0
11/14/2017	95.15	85.73	70.73	0.006	75.0
2/21/2018	93.28	85.03	70.73	0.006	72.0
5/24/2018	93.19	87.39	71.02	0.006	79.0
9/27/2018	92.15	83.77	67.60	0.005	71.1
12/28/2018	94.88	84.72	67.29	0.007	69.0
2/28/2019	97.83	89.83	71.31	0.005	71.3
3/1/2019	98.31	93.73	76.31	0.006	90.3

<sup>1</sup> Groundwater elevations from 6/15/04 to 2/21/08 were provided by DelTech; groundwater elevations from 5/27/08 to 3/7/2017 were provided by GEI; groundwater elevations from 6/27/2017 to 6/30/18 by SSAL; groundwater elevations from 9/27/2018 through present provided by CRWA.

<sup>2</sup> Measured clockwise with North as 0.0 degrees, Using graphical methods perpendicular to groundwater contours.

TOC = Top of Casing

msl = mean sea level

DTW = depth to water

btoc = below top of casing

**Table 4**  
**Groundwater Quality Monitoring Results**  
**Wild Wings Water Recycling Facility, Yolo County, CA**

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Nitrogen	Total	Coliform Bacteria	TTHM (1)	Lab
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	(total)	(fecal)	(E. coli)	(MPN/100 mL)	ug/L
Recommended	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100
Interim Limitation <sup>2</sup>	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-
MW-1	6/15/2004	STL	7.7	1410	112	391	2.1	<0.10	-	18.7	<0.05	<0.10	18.7	>23.0	<1.1	<1.1	<0.5
MW-1	3/29/2005	BSK	7.9	1200	160	360	3.7	<0.05	<0.01	27	<0.15	<1	27	2.2	<1.1	-	<0.5
MW-1	6/16/2005	BSK	7.7	1200	130	340	3.2	<0.05	<0.01	25	<0.20	<1	25	<1.1	<1.1	-	5.1
MW-1	9/29/2005	BSK	7.8	1200	130	310	3.2	<0.05	<0.01	27	<0.15	<1	27	<1.1	<1.1	-	<0.5
MW-1	12/6/2005	BSK	8.1	1100	120	340	2.9	<0.05	<0.01	27	<0.15	<1	27	<1.1	<1.1	<1.1	6.12
MW-1	2/16/2006	BSK	8.0	1300	110	340	2.7	<0.05	<0.01	27	<0.10	<1	27	<1.1	<1.1	-	<0.5
MW-1	5/16/2006	BSK	8.0	1100	130	300	3.4	<0.05	<0.01	27	<0.15	<1	27	<1.1	<1.1	-	<0.5
MW-1	8/21/2006	BSK	8.0	1000	120	270	3.6	<0.05	<0.01	25	<0.05	<0.10	<1.1	<1.1	<1.1	-	<0.5
MW-1	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	>23.0	<1.1	-	-	-
MW-1	2/16/2007													No sample retrieved			
MW-1	5/7/2007	BSK	8.0	1100	140	250	4.2	<0.05	<0.01	27	<0.05	<1.0	27	2.2	<1.1	-	<0.5
MW-1	8/29/2007	BSK	8.0	1100	110	240	3.6	<0.05	<0.01	24	*	<1.0	24	<1.1	<1.1	-	<0.5
MW-1	11/28/2007	BSK	8.0	1100	130	220	4.0	<0.05	<0.01	24	*	<1.0	26	<1.1	<1.1	-	<0.5
MW-1	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	<1.1	<1.1	-	-	-
MW-1	5/27/2008	CLS	7.3	1100	120	250	3.5	0.10	<0.02	23	<0.10	<0.10	23	13	-	-	<0.50
MW-1	8/27/2008	CLS	7.4	1100	120	230	3.6	<0.10	<0.02	24	<0.10	<0.10	24	<1.8	-	-	<0.50
MW-1	11/24/2008	CLS	7.4	1100	120	260	3.2	0.44	<0.02	25	<0.10	<0.10	25	<1.8	-	-	<0.50
MW-1	2/18/2009	CLS	980 (5)	130	170	4	<0.10	<0.02	19	<0.10	<0.10	19	<1.8	-	-	-	<0.50
MW-1	5/21/2009	CLS	7.3	1100	110	210	3.5	<0.10	<0.02	21	<0.10	<0.10	21	<1.8	-	-	<0.50
MW-1	8/4/2009	CLS	7.3	1100	96	240	3.1	0.13	<0.02	23	<0.10	<0.10	23	2.0	-	-	<0.50
MW-1	11/5/2009	CLS	7.16	1100 (5)	110	260	3.1	0.15	<0.02	24	<0.10	<0.10	24	<1.8	-	-	<0.50
MW-1	2/8/2010	CLS	7.4	1200	120	290	3.5	<0.10	<0.02	25	<0.10	<0.10	25	<1.8	-	-	<0.50
MW-1	5/7/2010	CLS	7.4	1100	120	280	3.0	<0.10	<0.02	25	<0.10	<0.10	25	<1.8	-	-	<0.50
MW-1	8/18/2010	CLS	7.2	1100	140	250	3.6	<0.10	<0.02	24	<0.10	<0.10	24	2.0	-	-	<0.50
MW-1	11/2/2010	CLS	7.4	1200	130	280	3.3	<0.10	<0.02	26	<0.10	<0.10	27	<1.8	-	-	<0.50
MW-1	2/23/2011	CLS	7.4	1100	130	270	3.6	<0.10	<0.02	26	<0.10	<0.10	26	<1.8	-	-	<0.50
MW-1	5/5/2011	CLS	7.4	1100	130	250	3.7	<0.10	<0.02	24	<0.10	<0.10	24	<1.8	-	-	<0.50
MW-1	8/16/2011	CLS	7.4	1200	140	200	4.2	<0.10	<0.02	24	<0.10	<0.10	24	<1.8	-	-	<0.50
MW-1	11/8/2011	CLS	7.3	1200	130	220	4.0	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	2/27/2012	CLS	7.3	1100	140	220	4.4	<0.10	<0.02	21	<0.10	<0.10	21	<1.8	-	-	<0.50
MW-1	5/21/2012	CLS	7.5	1100	130	230	4.0	<0.10	<0.02	23	<0.10	0.13	23	<1.8	-	-	<0.50
MW-1	8/9/2012	CLS	7.6	1100	130	210	3.9	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	11/19/2012	CLS	7.3	1200	120	220	3.5	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	2/21/2013	CLS	7.2	1100	140	200	4.1	<0.10	<0.02	19	<0.10	0.14	19	<1.8	-	-	<0.50
MW-1	5/15/2013	CLS	7.2	1200	130	220	4.1	<0.10	<0.02	23	<0.10	<0.10	23	<1.8	-	-	<0.50
MW-1	8/15/2013	CLS	7.3	1100	130	230	3.7	0.15	<0.02	22	<0.10	<0.10	22	<1.8	-	-	<0.50
MW-1	11/7/2013	CLS	7.4	1100	150	240	3.4	<0.10	<0.02	22	<0.10	<0.10	22	<1.8	-	-	<0.50
MW-1	2/25/2014	CLS	7.4	1100	100	260	3.5	<0.10	<0.02	22	<0.10	<0.10	22	<1.8	-	-	<0.50
MW-1	5/22/2014	CLS	7.4	1100	110	220	3.3	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	8/27/2014	CLS	7.5	1200	110	230	3.5	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	11/12/2014	CLS	7.36	1000 (7)	93	240	2.8	<0.10	<0.02	20	<0.10	<0.10	20	<1	-	-	<0.50
MW-1	2/26/2015	CLS	7.3	990	110	200	3.5	<0.10	<0.02	17	<0.10	<0.10	17	<1.8	-	-	<0.50
MW-1	5/13/2015	CLS	7.4	1100	100	200	3.5	<0.10	<0.02	17	<0.10	<0.10	17	<1.8	-	-	<0.50
MW-1	8/4/2015	CLS	7.3	1200	110	200	3.6	<0.10	<0.02	19	<0.10	<0.10	19	<1.8	-	-	<0.50
MW-1	11/5/2015	CLS	7.3	1200	100	220	3.2	<0.10	<0.02	20	<0.10	<0.10	20	<1.8	-	-	<0.50
MW-1	2/4/2016	CLS	7.3	1200	110	200	3.9	<0.10	<0.02	20	<0.40	<0.10	20	<1.8	-	-	<0.50
MW-1	6/30/2016	CLS	7.2	1100	110	180	3.9	<0.10	<0.02	16	<0.40	<0.10	16	<1.8	-	-	<0.50
MW-1	8/25/2016	CLS	7.3	990	100	170	3.3	<0.10	<0.02	16	<0.40	<0.10	16	2.0	-	-	8.5
MW-1	11/17/2016	CLS	7.4	1100	110	180	3.7	<0.10	<0.02	17	<0.40	<0.10	17	<1.8	-	-	<0.50
MW-1	3/7/2017	CLS	7.4	990	110	230	3.5	<0.10	<0.02	15	<0.40	0.18	15	<1.8	-	-	<0.50
MW-1	6/27/2017	CLS	7.1	1100	150	140	4.6	<0.10	<0.02	16	<0.40	0.19	16	2.0	-	-	<0.50
MW-1	8/23/2017	CLS	6.6	960	150	130	5.1	<0.10	<0.02	14	<0.40	<0.10	14	2.0	-	-	<0.50
MW-1	11/14/2017	CLS	7.2	960	150	120	5.1	<0.10	<0.02	11	<0.40	<0.10	11	<1.8	-	-	<0.50
MW-1	2/21/2018	CLS	7.4	960	140	120	5.4	<0.10	<0.02	12	<0.40	<0.10	12	<1.8	-	-	<0.50
MW-1	5/24/2018	CLS	7.4	970	120	120	6.1	<0.10	<0.02	18	<0.40	<0.10	18	<1.8	-	-	<0.50
MW-1	9/27/18	CLS	7.23	1,100	130	-	4.4	<0.10	<0.02	14	<0.40	<0.10	14	<1.8	-	-	<0.50

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Total Nitrogen (total) mg/L	Total Coliform	Coliform Bacteria	TTHM (1)	Lab
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L		(MPN/100 mL)	(fecal)	(E. coli)	(EPA 601)
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-
	MW-1	12/28/18	CLS	7.32	900	120	230	3.4	<0.10	<0.02	18	<0.40	<0.10	18	<1.8	-	-
MW-1	2/28/19	CLS	7.35	1,100	140	-	4.8	0.16	<0.02	10	<0.40	<0.10	10	<1.8	-	-	<0.50
MW-1	6/26/19	CLS	7.44	1,000	140	110	5.2	<1.10	<.01	9.4	<.40	<.10	9.5	<1.8	-	-	<0.50
MW-2	6/15/2004	STL	7.6	884	147	78.4	5.9	<0.10	-	11.9	<0.05	<0.10	11.9	23	<1.1	<1.1	<0.5
MW-2	3/29/2005	BSK	7.8	880	200	95	7.2	<0.05	<0.01	11	<0.15	<1	11	1.1	<1.1	-	<0.5
MW-2	6/16/2005	BSK	7.6	920	150	100	5.5	<0.05	<0.01	11	<0.10	<1	11	>23.0	<1.1	-	4
MW-2	9/29/2005	BSK	7.8	960	170	110	5.8	<0.05	<0.01	12	<0.15	<1	12	5.1	<1.1	-	<0.5
MW-2	12/6/2005	BSK	8	970	180	130	6.1	<0.05	<0.01	12	<0.10	<1	12	1.1	<1.1	<1.1	1.8
MW-2	2/16/2006	BSK	7.9	940	150	120	5.4	<0.05	<0.01	11	<0.10	<1	11	<1.1	<1.1	-	1.6
MW-2	5/16/2006	BSK	8	1,000	170	120	5.9	<0.05	<0.01	13	<0.15	4	13	<1.1	<1.1	-	1.6
MW-2	8/21/2006	BSK	7.9	1,000	150	140	5.2	<0.05	<0.01	14	<0.05	<0.10	-	<1.1	<1.1	-	<0.5
MW-2	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	-	>23.0	<1.1	-	-
MW-2	2/16/2007													No sample retrieved			
MW-2	5/7/2007	BSK	7.9	920	170	120	6	<0.05	<0.01	11	<0.05	<1.0	11	<1.1	<1.1	-	<0.5
MW-2	8/29/2007	BSK	7.9	850	130	110	4.8	<0.05	<0.01	10	*	<1.0	10	<1.1	<1.1	-	1.14
MW-2	11/28/2007	BSK	7.8	890	150	100	5.3	<0.05	<0.01	11	*	<1.0	11	<1.1	<1.1	-	<0.5
MW-2	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	-	1.1	<1.1	-	-
MW-2	5/27/2008	CLS	7	910	170	97	5.7	<0.10	<0.01	9.1	<0.10	<0.10	9.2	<1.8	-	-	<0.50
MW-2	8/27/2008	CLS	7	910	150	100	5	<0.10	<0.02	9.5	<0.10	0.11	9.6	<1.8	-	-	<0.50
MW-2	11/24/2008	CLS	7.2	950	150	100	5	<0.10	<0.02	9.1	<0.10	<0.10	9.1	79	-	-	<0.50
MW-2	2/18/2009	CLS	-	880 (5)	140	100	4.9	<0.10	<0.02	8.2	<0.10	<0.10	8.5	6.8	-	-	<0.50
MW-2	5/21/2009	CLS	7.1	870	140	89	4.7	<0.10	<0.02	8.1	<0.10	<0.10	8.3	<1.8	-	-	<0.50
MW-2	8/4/2009	CLS	7	860	120	91	4.2	<0.10	<0.02	8	<0.10	<0.10	8	<1.8	-	-	<0.50
MW-2	11/5/2009	CLS	-	790 (5)	150	100	4.8	<0.10	<0.02	7.9	<0.10	<0.10	8	<1.8	-	-	<0.50
MW-2	2/8/2010	CLS	7.2	960	170	110	5.6	0.1	<0.02	7.9	<0.10	<0.10	7.9	7.8	-	-	<0.50
MW-2	5/7/2010	CLS	7.1	950	160	120	5.1	<0.10	<0.02	7.5	<0.10	<0.10	7.5	<1.8	-	-	<0.50
MW-2	8/18/2010	CLS	7.1	1,000	180	130	5.7	0.22	<0.02	8.3	<0.10	0.11	8.5	<1.8	-	-	<0.50
MW-2	11/2/2010	CLS	7.1	1,100	210	140	6.1	<0.10	<0.02	8.4	<0.10	<0.10	8.7	<1.8	-	-	<0.50
MW-2	2/23/2011	CLS	7.1	1,200	160	160	5.7	<0.10	<0.02	8.5	<0.10	0.17	11	13	-	-	<0.50
MW-2	5/5/2011	CLS	7.1	970	160	150	5.6	<0.10	<0.02	7.3	<0.10	<0.10	7.6	<1.8	-	-	<0.50
MW-2	8/16/2011	CLS	7.1	1,100	190	170	6.6	0.17	<0.02	9.4	<0.10	<0.10	9.6	<1.8	-	-	<0.50
MW-2	11/8/2011	CLS	7	1,200	180	170	6.3	<0.10	<0.02	8.8	<0.10	<0.10	8.8	<1.8	-	-	<0.50
MW-2	2/27/2012	CLS	7	1,100	190	140	7	<0.10	<0.02	8	<0.10	<0.10	8.2	<1.8	-	-	<0.50
MW-2	5/21/2012	CLS	7.1	990	180	130	7.3	<0.10	<0.02	8.2	<0.10	0.2	8.4	2	-	-	<0.50
MW-2	8/9/2012	CLS	7.4	1,000	140	120	4.7	<0.10	<0.02	8.8	<0.10	0.11	9	<1.8	-	-	<0.50
MW-2	11/19/2012	CLS	7	1000	170	110	6	<0.10	<0.02	8.6	<0.10	<0.10	8.9	2	-	-	<0.50
MW-2	2/21/2013	CLS	7	930	170	100	6.2	0.14	<0.02	8.7	<0.10	0.12	8.9	14	-	-	<0.50
MW-2	5/15/2013	CLS	7.1	940	170	120	6.2	<0.10	<0.02	8.6	<0.10	<0.10	8.7	<1.8	-	-	<0.50
MW-2	8/15/2013	CLS	7	990	160	120	5.2	<0.10	<0.02	8.3	<0.10	<0.10	8.6	<1.8	-	-	<0.50
MW-2	11/7/2013	CLS	7	900	150	110	5.7	<0.10	<0.02	8.1	<0.10	0.17	8.4	<1.8	-	-	<0.50
MW-2	2/25/2014	CLS	7.1	830	140	86	5.9	<0.10	<0.02	8.4	<0.10	<0.10	8.6	<1.8	-	-	<0.50
MW-2	5/22/2014	CLS	7	830	140	73	5.6	<0.10	<0.02	8.1	<0.10	<0.10	8.1	<1.8	-	-	<0.50
MW-2	8/27/2014													No sample retrieved			
MW-2	11/12/2014													No sample retrieved			
MW-2	2/26/2015	CLS	7	800	130	87	5.3	<0.10	<0.02	8.3	<0.10	<0.10	8.4	<1.8	-	-	<0.50
MW-2	5/13/2015	CLS	7.2	830	130	86	5.3	<0.10	<0.02	9.2	<0.10	<0.10	9.3	<1.8	-	-	<0.50
MW-2	8/4/2015	CLS	7.2	830	150	88	5.4	<0.10	<0.02	8.3	<0.10	<0.10	8.5	<1.8	-	-	<0.50
MW-2	11/5/2015	CLS	7.1	920	130	84	4.5	<0.10	<0.02	8.5	<0.10	<0.10	8.6	<1.8	-	-	<0.50
MW-2	2/4/2016	CLS	7.1	840	140	83	5.4	<0.10	<0.02	9	<0.40	<0.10	9.2	<1.8	-	-	<0.50
MW-2	6/30/2016	CLS	7	770	130	83	5.1	<0.10	<0.02	9.2	<0.40	<0.10	9.2	<1.8	-	-	0.68
MW-2	8/25/2016	CLS	7.1	820	150	88	4.8	<0.10	<0.02	9.7	<0.40	0.17	9.7	<1.8	-	-	2.1
MW-2	11/17/2016	CLS	7.3	820	140	94	4.9	<0.10	<0.02	10	<0.40	0.12	11	<1.8	-	-	<0.50
MW-2	3/7/2017	CLS	7.2	840	140	120	5.4	<0.10	<0.02	8.8	<0.40	<0.10	9	<1.8	-	-	<0.50
MW-2	6/27/2017	CLS	6.9	940	160	130	5.5	<0.10	<0.02	16	--	0.12	16	7.8	-	-	<0.50
MW-2	8/23/2017	CLS	7.1	960	180	130	6.3	<0.10	<0.02	18	<0.40	<0.10	18	17	-	-	<0.50
MW-2	11/14/2017	CLS	7.1	1000	170	140	6.2	<0.10	<0.02	21	<0.40	0.1	21	4.5	-	-	<0.50
MW-2	2/21/2018	CLS	7.1	1000	160	130	6.3	<0.10	<0.02	19	<0.40	<0.10	19	7.8	-	-	<0.50
MW-2	5/24/2018	CLS	7.1	970	150	130	6.1	<0.10	<0.02	18	<0.40	<0.10	18	<1.8	-	-	<0.50
MW-2	9/27/18	CLS	7.03	990	170	-	6.0	<0.10	<0.02	16	<0.40	<0.10	16	<1.8	-	-	<0.50

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Total Nitrogen (total) mg/L	Coliform Bacteria	TTTHM (1)	Lab	
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L		(fecal)	(E. coli)	(EPA 601)	ug/L
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-
	MW-2	2/28/19	CLS	7.17	990	160	-	5.7	<0.10	<0.02	14	<0.40	<0.10	14	240	-	-
MW-2	2/28/19	CLS	7.17	990	160	-	5.7	<0.10	<0.02	14	<0.40	<0.10	14	240	-	-	<0.50
MW-2	6/26/19	CLS	7.47	1000	150	110	5.9	<100	<.01	13	<.40	<.10	13	<1.8	-	-	9.6
<hr/>																	
MW-3	6/15/2004	STL	7.7	435	90.6	34.8	1.7	<0.10	-	1.7	<0.05	<0.10	1.7	23	<1.1	<1.1	<0.5
MW-3	3/29/2005	BSK	7.8	390	96	38	1.5	<0.05	<0.01	2.9	<0.05	<1	2.9	>23.0	1.1	-	<0.5
MW-3	6/16/2005	BSK	7.6	380	81	26	1.2	<0.05	<0.01	0.7	<0.10	<1	0.7	5.1	<1.1	-	1.6
MW-3	9/29/2005	BSK	7.8	620	120	57	2.0	<0.05	<0.01	1.8	<0.10	<1	1.8	>23.0	12	-	0.79
MW-3	12/6/2005	BSK	8.1	610	140	62	2.1	<0.05	<0.01	1.6	<0.10	<1	1.6	>23.0	3.6	3.6	5.4
MW-3	2/16/2006	BSK	7.9	380	74	31	1.1	0.1	<0.01	1.4	<0.05	<1	1.4	16.1	1.1	-	<0.5
MW-3	5/16/2006	BSK	8.0	420	72	32	1.1	<0.05	<0.01	1.6	<0.05	<1	1.6	>23.0	5.1	-	2.6
MW-3	8/21/2006	BSK	8.0	480	110	49	1.7	0.15	<0.01	0.9	<0.05	<0.10	-	<1.1	-	-	<0.5
MW-3	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	-	>23.0	<1.1	-	-
MW-3	2/16/2007													No sample retrieved			
MW-3	5/7/2007	BSK	7.9	550	160	65	2.0	<0.05	<0.01	0.54	<0.05	<1.0	2.2	<1.1	-	-	<0.5
MW-3	8/29/2007	BSK	7.9	690	160	92	2.4	<0.05	<0.01	1.4	*	<1.0	1.4	>23.0	<1.1	-	<0.5
MW-3	11/28/2007	BSK	7.8	770	170	94	2.4	0.27	0.45	2.3	*	<1.0	5.3	23	2.2	-	<0.5
MW-3	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	-	12	<1.1	-	-
MW-3	5/28/2008	CLS	7.0	530	120	56	1.7	7.1	0.17	2.1	<0.10	<0.10	9.4	280	-	-	<0.5
MW-3	8/27/2008	CLS	7.0	640	160	69	2.0	<0.10	<0.02	2.0	<0.10	0.12	2.7	540	-	-	<0.5
MW-3	11/25/2008	CLS	7.1	680	170	67	2.1	0.34	0.19	0.58	<0.10	0.17	1.6	240	-	-	<0.5
MW-3	2/19/2009	CLS	-	580(5)	130	75	1.8	0.69	0.14	1.3	<0.10	0.14	2.6	>1600	-	-	<0.5
MW-3	5/21/2009	CLS	7.1	500	130	53	1.6	20	0.68	<0.5	<0.10	<0.10	1.2	79	-	-	<0.5
MW-3	8/5/2009	CLS	7.0	690	130	73	1.8	0.31	0.04	0.55	<0.10	0.14	1.8	430	-	-	<0.5
MW-3	11/5/2009	CLS	-	600(5)	160	77	2.1	0.33	0.25	1.0	<0.10	0.64	2.8	>1600	-	-	<0.5
MW-3	2/8/2010	CLS	7.0	530	130	52	1.7	0.55	0.04	0.69	<0.10	0.15	1.5	1600	-	-	<0.5
MW-3	5/7/2010	CLS	6.9	580	140	78	1.6	<0.10	0.06	1.1	<0.10	0.26	2.6	23	-	-	<0.5
MW-3	8/18/2010	CLS	7.1	670	200	87	2.4	2.7	0.50	1.2	<0.10	0.93	3.4	350	-	-	5.2
MW-3	11/2/2010	CLS	7.0	870	200	120	2.8	0.28	0.46	5.3	<0.10	0.36	7.2	280	-	-	1.5
MW-3	2/24/2011	CLS	6.7	590	140	73	1.8	<0.10	<0.02	1.6	<0.10	0.17	2.5	1600	-	-	<0.5
MW-3	5/5/2011	CLS	6.9	650	130	95	1.9	0.11	0.03	4.0	<0.10	0.3	4.6	33	-	-	<0.5
MW-3	8/16/2011	CLS	7.4	910	170	120	3.2	<0.10	<0.02	5.0	<0.10	<0.10	5.4	94	-	-	<0.5
MW-3	11/8/2011	CLS	7.0	920	180	130	2.7	2.0	0.35	3.7	<0.10	0.56	4.9	63	-	-	<0.5
MW-3	2/27/2012	CLS	6.9	740	180	110	2.4	5.5	0.33	2	<0.10	0.43	3.2	49	-	-	<0.5
MW-3	5/21/2012	CLS	7.0	760	160	98	2.3	<0.10	0.03	2.1	<0.10	0.13	3	13	-	-	<0.5
MW-3	8/9/2012	CLS	7.3	850	180	110	2.3	0.22	0.03	2.9	<0.10	0.37	3.5	<1.8	-	-	1.7
MW-3	11/19/2012	CLS	7.0	900	180	120	2.3	0.59	0.18	4.1	<0.10	0.31	5.4	130	-	-	<0.5
MW-3	2/21/2013	CLS	6.9	670	170	110	2.0	0.18	0.04	2.4	<0.10	0.35	3.2	4	-	-	<0.5
MW-3	5/15/2013	CLS	7.0	710	160	110	2.1	<0.10	0.07	1.8	<0.10	<0.10	2.1	<1.8	-	-	0.93
MW-3	8/16/2013	CLS	7.4	630(5)	140	82	1.8	9.10	0.15	1.6	<0.10	0.16	3.7	<1.8	-	-	0.63
MW-3	11/7/2013	CLS	6.9	620	150	81	1.4	<0.10	0.07	1.8	<0.10	0.12	2.5	<1.8	-	-	<0.5
MW-3	2/25/2014	CLS	7.2	760	180	170	2.3	3.10	0.13	2.7	<0.10	0.32	3.3	>1600	-	-	<0.5
MW-3	5/22/2014	CLS	7.0	860	170	170	2.3	0.96	0.03	1.9	<0.10	<0.10	2.3	<1.8	-	-	<0.5
MW-3	8/27/2014	CLS	7.1	900	150	170	1.9	0.55	0.13	1.8	<0.10	0.2	2.4	<1.8	-	-	0.62
MW-3	11/12/2014	CLS												No sample retrieved			
MW-3	2/25/2015	CLS	7.0	650	130	110	1.9	<0.10	<0.02	1.1	<0.10	<0.10	1.7	920	-	-	<0.5
MW-3	5/13/2015	CLS	7.0	700	140	150	1.7	0.26	<0.02	2.4	<0.10	<0.10	2.6	<1.8	-	-	<0.5
MW-3	8/4/2015	CLS	7.0	700	150	120	1.9	16.00	0.32	2.1	<0.10	0.3	2.7	<1.8	-	-	<0.5
MW-3	11/5/2015	CLS												No sample retrieved			
MW-3	2/4/2016	CLS	7.1	980	210	230	2.1	<0.10	<0.02	1.7	<0.4	0.25	2.4	220	-	-	<0.5
MW-3	6/30/2016	CLS	7.0	740	150	150	2.1	11.00	0.18	2.2	<0.4	0.16	3.1	9	-	-	3.1
MW-3	8/25/2016	CLS												No sample retrieved			
MW-3	11/17/2016	CLS												No sample retrieved			
MW-3	3/7/2017	CLS	7.2	420	84	52	0.94	1.10	0.10	<0.4	<0.4	0.17	0.95	23	-	-	<0.5
MW-3	6/27/2017	CLS	6.9	510	120	66	1.3	<0.10	<0.10	0.9	<0.4	0.44	4.6	540	-	-	<0.5
MW-3	8/23/2017	CLS	7.3	610	170	55	2.1	0.12	<0.02	0.48	<0.4	0.33	1.7	>1600	-	-	<0.5
MW-3	11/14/2017	CLS	7.1	580	130	78	1.7	<0.10	0.039	1.6	<0.4	0.13	4.2	13	-	-	<0.5
MW-3	2/21/2018	CLS	7.1	690	180	110	2.3	<0.10	0.30	0.94	<0.4	0.26	2.2	220	-	-	<0.5
MW-3	5/24/2018	CLS	7.3	620	140	81	2	<0.10	<0.20	1.7	<0.4	<0.1	2.0	13	-	-	<0.5
MW-3	9/27/2018	CLS												No sample retrieved			

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Total Nitrogen (total) mg/L	Total Coliform	Coliform Bacteria	TTHM (1)	Lab
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L		(MPN/100 mL)	(fecal)	(E. coli)	(EPA 601)
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-
MW-3	12/28/2018	CLS	6.91	690	220	170	2.2	<0.10	<0.20	2.6	<0.4	<0.1	3.1	<1.8	-	-	33
MW-3	2/28/2019	CLS	6.96	440	79	-	0.91	<0.10	<0.20	<0.4	<0.4	<0.1	0.53	>1600	-	-	<0.5
MW-3	6/26/2019	CLS	7.28	630	120	85	1.9	0.97	0.15	1.7	<.40	<0.1	2.10	33	-	-	9.1
MW-4	6/15/2004	STL	8	647	53.3	138	1	0.87	--	8.4	<0.05	<0.10	8.4	9.2	<1.1	<1.0	<0.5
MW-4	3/29/2005	BSK	8.1	570	69	170	1.2	<0.05	<0.01	9.7	<0.10	<1	9.7	23	<1.1	-	<0.5
MW-4	6/16/2005	BSK	8	600	59	170	1	<0.05	<0.01	9.7	<0.10	<1	9.7	<1.1	<1.1	-	0.81
MW-4	9/29/2005	BSK															3
MW-4	12/6/2005	BSK	8.2	570	55	180	1.1	<0.05	<0.01	9.9	<0.10	<1	9.9	<1.1	<1.1	<1.1	1.4
MW-4	2/16/2006	BSK	8.1	590	49	180	0.96	<0.05	<0.01	9.7	<0.10	<1	9.7	<1.1	<1.1	-	1.8
MW-4	5/16/2006	BSK	8.2	650	56	180	1.1	<0.05	<0.01	9.9	<0.10	<1	9.9	<1.1	<1.1	-	0.99
MW-4	8/21/2006	BSK	8.2	590	49	170	1	<0.05	<0.01	9.7	<0.05	<0.10	-	>23.0	9.2	-	<0.5
MW-4	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	-	<1.1	<1.1	-	-
MW-4	2/16/2007																
MW-4	5/7/2007	BSK	8.2	560	54	170	1.1	<0.05	<0.01	44 (4)	<0.05	<1.0	44 (4)	<1.1	<1.1	-	<0.5
MW-4	8/29/2007	BSK	8.2	570	47	180	1.1	<0.05	<0.01	9.5	*	<1.0	9.5	6.9	<1.1	-	<0.5
MW-4	11/28/2007	BSK	8.1	570	52	190	1	<0.05	<0.01	11	*	<1.0	11	<1.1	<1.1	-	<0.5
MW-4	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	-	<1.1	<1.1	-	-
MW-4	5/27/2008	CLS	7.7	550	51	180	1	<0.10	<0.02	9.4	<0.10	<0.10	9.5	<1.8	-	-	<0.50
MW-4	8/28/2008	CLS	7.5	560	52	170	0.94	<0.10	<0.02	9.5	<0.10	<0.10	9.7	<1.8	-	-	<0.50
MW-4	11/25/2008	CLS	7.8	620	51	190	0.98	<0.10	<0.02	10	<0.10	<0.10	10	<1.8	-	-	<0.50
MW-4	2/19/2009	CLS	-	650(5)	53	190	1.2	<0.10	<0.02	10	<0.10	<0.10	10	<1.8	-	-	<0.50
MW-4	5/21/2009	CLS	7.9	620	50	170	0.98	<0.10	<0.02	9.3	<0.10	<0.10	9.3	<1.8	-	-	<0.50
MW-4	8/5/2009	CLS	7.6	600	41	190	0.88	<0.10	<0.02	10	<0.10	<0.10	10	<1.8	-	-	<0.50
MW-4	11/5/2009	CLS	7.8 (6)	710(5)	53	190	1	<0.10	<0.02	10	<0.10	<0.10	10	<1.8	-	-	<0.50
MW-4	2/8/2010	CLS	7.8	630	59	210	1.2	0.15	<0.02	11	<0.10	<0.10	11	<1.8	-	-	<0.50
MW-4	5/7/2010	CLS	7.6	710	54	220	0.96	0.12	<0.02	12	<0.10	<0.10	12	<1.8	-	-	<0.50
MW-4	8/18/2010	CLS	7.6	560	59	200	1.1	<0.10	<0.02	11	<0.10	<0.10	11	<1.8	-	-	<0.50
MW-4	11/2/2010	CLS	7.8	650	66	210	1.2	<0.10	<0.02	11	<0.10	<0.10	11	<1.8	-	-	<0.50
MW-4	2/23/2011	CLS	7.7	680	57	220	1.1	<0.10	<0.02	12	<0.10	<0.10	12	<1.8	-	-	<0.50
MW-4	5/5/2011	CLS	7.8	810	53	230	0.98	<0.10	<0.02	12	<0.10	<0.10	12	<1.8	-	-	<0.50
MW-4	8/16/2011	CLS	8	690	58	210	1.1	<0.10	<0.02	12	<0.10	<0.10	12	<1.8	-	-	<0.50
MW-4	11/8/2011	CLS	7.7	630	57	210	1	<0.10	<0.02	11	<0.10	<0.10	11	<1.8	-	-	<0.50
MW-4	2/27/2012	CLS	7.7	610	62	210	1.2	<0.10	<0.02	11	<0.10	<0.10	11	<1.8	-	-	<0.50
MW-4	5/21/2012	CLS	7.7	650	58	210	1.2	<0.10	<0.02	12	<0.10	0.26	12	<1.8	-	-	<0.50
MW-4	8/9/2012	CLS	8	600	63	220	1.1	<0.10	<0.02	12	<0.10	0.19	12	<1.8	-	-	<0.50
MW-4	11/19/2012	CLS	7.6	610	55	210	1	<0.10	<0.02	12	<0.10	<0.10	12	<1.8	-	-	<0.50
MW-4	2/21/2013	CLS	7.6	670	66	230	1.1	<0.10	<0.02	15	<0.10	<0.10	15	<1.8	-	-	<0.50
MW-4	5/15/2013	CLS	7.6	680	57	240	1.1	0.21	<0.02	15	<0.10	<0.10	15	<1.8	-	-	<0.50
MW-4	8/16/2013	CLS	7.7	870(5)	58	250	1.1	<0.10	<0.02	14	<0.10	0.14	14	<1.8	-	-	<0.50
MW-4	11/7/2013	CLS	7.6	670	56	250	1	<0.10	<0.02	14	<0.10	0.14	14	<1.8	-	-	<0.50
MW-4	2/25/2014	CLS	7.7	830	70	250	1	<0.10	<0.02	14	<0.10	<0.10	14	<1.8	-	-	<0.50
MW-4	5/22/2014	CLS	7.8	700	57	230	1.1	<0.10	<0.02	13	<0.10	<0.10	13	<1.8	-	-	<0.50
MW-4	8/27/2014	CLS	7.8	840	58	250	1	<0.10	<0.02	14	<0.10	<0.10	14	<1.8	-	-	<0.50
MW-4	11/12/2014	CLS	7.7 (6)	749(7)	54	260	1	<0.10	<0.02	15	<0.10	<0.10	15	<1	-	-	<0.50
MW-4	2/26/2015	CLS	7.7	720	52	260	1	<0.10	<0.02	16	<0.10	<0.10	16	<1.8	-	-	<0.50
MW-4	5/13/2015	CLS	7.8	770	53	250	1	<0.10	<0.02	15	<0.10	<0.10	15	<1.8	-	-	<0.50
MW-4	8/4/2015	CLS	7.8	750	56	240	1	<0.10	<0.02	16	<0.10	<0.10	16	<1.8	-	-	<0.50
MW-4	11/5/2015	CLS	7.8	970	60	240	1.1	<0.10	<0.02	17	<0.10	<0.10	17	<1.8	-	-	<0.50
MW-4	2/4/2016	CLS	7.8	760	49	240	0.82	<0.10	<0.02	17	0.17	0.17	17	<1.8	-	-	<0.50
MW-4	6/30/2016	CLS	7.6	690	50	240	0.95	<0.10	<0.02	16	<0.40	<0.10	16	<1.8	-	-	<0.50
MW-4	8/25/2016	CLS	7.7	560	56	220	0.88	<0.10	<0.02	16	<0.40	0.14	16	<1.8	-	-	12
MW-4	11/17/2016	CLS	7.7	660	50	220	0.85	<0.10	<0.02	17	<0.40	<0.10	17	<1.8	-	-	<0.50
MW-4	3/7/2017	CLS	7.7	670	49	250	0.95	<0.10	<0.02	14	<0.40	<0.10	14	<1.8	-	-	<0.50
MW-4	6/27/2017	CLS	7.5	680	55	230	0.87	<0.10	<0.02	15	<0.40	<0.10	15	<1.8	-	-	<0.50
MW-4	8/23/2017	CLS	7.5	630	57	220	1	<0.10	<0.02	14	<0.40	<0.10	14	79	-	-	<0.50
MW-4	11/14/2017	CLS	7.5	660	58	240	0.97	<0.10	<0.02	15	<0.40	0.13	15	540	-	-	<0.50
MW-4	2/21/2018	CLS	7.8	610	53	220	0.96	<0.10	<0.02	14	<0.40	<0.10	15	49	-	-	<0.50
MW-4	5/24/2018	CLS	7.7	620	47	210	0.93	<0.10	<0.02	14	<0.40	<0.10	14	2	-	-	<0.50
MW-4	9/27/18	CLS	7.76	610	54	-	0.97	<0.10	<0.02	15	<0.40	<0.10	3	<1.8	-	-	<0.50

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Total Nitrogen (total) mg/L	Total Coliform	Coliform Bacteria	TTHM (1)	Lab
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L		(MPN/100 mL)	(fecal)	(E. coli)	(EPA 601)
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-
MW-4	12/28/18	CLS	7.8	530	52	220	0.88	<0.10	<0.02	15	<0.40	<0.10	15	<1.8	-	-	2
MW-4	2/28/19	CLS	7.77	780	51	-	0.88	<0.10	<0.02	12	<0.40	<0.10	15	4.5	-	-	<0.50
MW-4	6/26/19	CLS	7.88	760	50	230	0.88	<0.10	<0.01	14	<0.40	<0.10	14	<1.8	-	-	4.1
MW-5R	6/15/2004	STL	8.1	461	91.7	42.3	2.1	<0.10	-	1.6	<0.05	<0.10	1.6	>23.0	<1.1	<1.1	<0.5
MW-5R	3/29/2005	BSK	8.2	490	120	48	2.6	<0.05	<0.01	2	<0.10	<1	2	5.1	<1.1	-	<0.5
MW-5R	6/16/2005	BSK	8.2	450	95	49	2	<0.05	<0.01	1.4	<0.10	<1	1.4	1.1	<1.1	-	4
MW-5R	9/29/2005	BSK	8.2	430	92	48	2	<0.05	<0.01	1.1	<0.10	<1	1.1	1.1	<1.1	-	<0.5
MW-5R	6/12/2005	BSK	8.4	430	92	51	2.1	<0.05	<0.01	1.6	<0.10	<1	1.6	<1.1	<1.1	<1.1	1.8
MW-5R	2/16/2006	BSK	8.3	450	91	48	2	<0.05	<0.01	1.7	<0.10	<1	1.7	<1.1	<1.1	-	1.6
MW-5R	5/16/2006	BSK	8.3	360	92	47	2.1	<0.05	<0.01	1.1	<0.10	<1	1.1	<1.1	<1.1	-	1.6
MW-5R	8/21/2006	BSK	8.3	420	78	47	1.8	<0.05	<0.01	1.1	<0.05	<0.10	-	<1.1	<1.1	-	<0.5
MW-5R	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	23	<1.1	-	-	-
MW-5R	2/16/2007													No sample retrieved			
MW-5R	7/5/2007	BSK	8.3	420	89	49	2	<0.05	<0.01	1.1	<0.05	<1.0	1.1	<1.1	<1.1	-	<0.5
MW-5R	8/29/2007	BSK	8.3	470	91	44	1.9	<0.05	<0.01	2	*	<1.0	2	<1.1	<1.1	-	1.14
MW-5R	11/28/2007	BSK	8.2	460	95	45	2.1	<0.05	<0.01	2.1	*	<1.0	2.1	1.1	<1.1	-	<0.5
MW-5R	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	-	<1.1	<1.1	-	-
MW-5R	5/28/2008	CLS	7.7	450	97	44	2.1	<0.05	<0.01	1.4	<0.10	<0.10	1.5	<1.8	-	-	<0.50
MW-5R	8/27/2008	CLS	7.9	450	91	44	2	<0.10	<0.02	1.5	<0.10	<0.10	1.7	<1.8	-	-	<0.50
MW-5R	11/24/2008	CLS	7.9	470	93	46	2	<0.10	<0.02	1.8	<0.10	<0.10	1.9	<1.8	-	-	<0.50
MW-5R	2/18/2009	CLS	-	470(5)	92	48	2.1	<0.10	<0.02	1.8	<0.10	<0.10	2	<1.8	-	-	<0.50
MW-5R	5/21/2009	CLS	7.9	470	86	44	1.9	<0.10	<0.02	1.6	<0.10	<0.10	1.6	<1.8	-	-	<0.50
MW-5R	4/8/2009	CLS	7.9	480	78	44	1.9	<0.10	<0.02	1.7	<0.10	<0.10	1.7	<1.8	-	-	<0.50
MW-5R	5/11/2009	CLS	7.7(6)	450(5)	98	44	2.1	<0.10	<0.02	1.7	<0.10	<0.10	1.8	<1.8	-	-	<0.50
MW-5R	8/2/2010	CLS	7.9	490	110	45	2.4	0.12	<0.02	2	<0.10	<0.10	2	<1.8	-	-	<0.50
MW-5R	7/5/2010	CLS	7.9	490	100	43	2.1	<0.10	<0.02	2.2	<0.10	<0.10	2.2	<1.8	-	-	<0.50
MW-5R	8/18/2010	CLS	7.8	520	120	43	2.2	<0.10	<0.02	2.6	<0.10	<0.10	2.9	110	-	-	<0.50
MW-5R	2/11/2010	CLS	8	560	120	42	2.2	<0.10	<0.02	2.8	<0.10	<0.10	2.8	<1.8	-	-	<0.50
MW-5R	2/23/2011	CLS	7.9	520	100	42	2.2	<0.10	<0.02	3	<0.10	<0.10	3.4	<1.8	-	-	<0.50
MW-5R	5/5/2011	CLS	7.9	380	92	45	1.9	<0.10	<0.02	2.9	<0.10	<0.10	2.9	2	-	-	<0.50
MW-5R	8/16/2011	CLS	7.9	470	100	50	2.2	<0.10	<0.02	1.8	<0.10	<0.10	1.8	<1.8	-	-	<0.50
MW-5R	8/11/2011	CLS	7.9	460	97	46	2.1	<0.10	<0.02	2.1	<0.10	<0.10	2.1	<1.8	-	-	<0.50
MW-5R	2/27/2012	CLS	7.9	460	110	45	2.3	<0.10	<0.02	2.3	<0.10	<0.10	2.3	<1.8	-	-	<0.50
MW-5R	5/21/2012	CLS	8	440	100	44	2.3	<0.10	<0.02	2.4	<0.10	<0.10	2.6	<1.8	-	-	<0.50
MW-5R	9/8/2012	CLS	8.1	510	120	42	2.5	<0.10	<0.02	2.5	<0.10	<0.10	2.7	<1.8	-	-	<0.50
MW-5R	11/19/2012	CLS	7.9	480	100	39	2.1	<0.10	<0.02	2.5	<0.10	<0.10	2.6	<1.8	-	-	<0.50
MW-5R	2/21/2013	CLS	7.8	490	100	39	2.1	<0.10	<0.02	2.2	<0.10	<0.10	2.2	4.5	-	-	<0.50
MW-5R	5/15/2013	CLS	7.7	460	100	48	2.2	<0.10	<0.02	2.5	<0.10	<0.10	2.6	<1.8	-	-	<0.50
MW-5R	8/15/2013	CLS	7.9	480	110	45	2	<0.10	<0.02	2.7	<0.10	<0.10	3.1	<1.8	-	-	<0.50
MW-5R	7/11/2013	CLS	7.8	480	110	45	2.1	<0.10	<0.02	2.7	<0.10	<0.10	3	<1.8	-	-	<0.50
MW-5R	2/25/2014	CLS	8	520	110	41	2.3	<0.10	<0.02	2.7	<0.10	<0.10	2.8	<1.8	-	-	<0.50
MW-5R	5/22/2014	CLS	8	490	96	38	2	<0.10	<0.02	2.5	<0.10	<0.10	2.5	<1.8	-	-	<0.50
MW-5R	8/27/2014	CLS	8	530	98	40	2	<0.10	<0.02	2.7	<0.10	<0.10	2.7	<1.8	-	-	<0.50
MW-5R	11/12/2014	CLS	7(6)	534 (7)	99	35	2.1	<0.10	<0.02	3.2	<0.10	<0.10	3.2	<1	-	-	<0.50
MW-5R	2/26/2015	CLS	7.9	520	100	39	2.2	<0.10	<0.02	3.4	<0.10	<0.10	3.5	<1.8	-	-	<0.50
MW-5R	5/13/2015	CLS	8	520	98	43	2.1	<0.10	<0.02	3.3	<0.10	<0.10	3.3	<1.8	-	-	<0.50
MW-5R	8/4/2015	CLS	7.9	530	110	40	2.1	<0.10	<0.02	3.3	<0.10	<0.10	3.6	<1.8	-	-	<0.50
MW-5R	11/5/2015	CLS	7.9	560	95	38	1.9	<0.10	<0.02	3.1	<0.10	<0.10	3.2	<1.8	-	-	<0.50
MW-5R	2/4/2016	CLS	8	550	99	38	2.1	0.18	<0.02	3.1	<0.40	<0.10	3.2	<1.8	-	-	<0.50
MW-5R	6/30/2016	CLS	7.8	500	96	38	2.1	<0.10	<0.02	2.9	<0.40	<0.10	3.2	<1.8	-	-	0.68
MW-5R	8/25/2016	CLS	7.9	490	110	40	2	<0.10	<0.02	2.9	<0.40	<0.10	2.9	<1.8	-	-	2.1
MW-5R	11/17/2016	CLS	8	500	100	39	2	<0.10	<0.02	3	<0.40	<0.10	3.2	<1.8	-	-	<0.50
MW-5R	3/7/2017	CLS	7.7	470	77	34	1.7	<0.10	0.058	2	<0.40	0.24	2.4	920	-	-	<0.50
MW-5R	6/27/2017	CLS	7.1	290	21	4	0.3	<0.10	<0.02	<0.40	<0.40	0.12	0.81	170	<0.50	-	-
MW-5R	8/23/2017	CLS	7.7	400	64	41	1.5	<0.10	<0.02	1.5	<0.40	0.31	1.9	33	-	-	<0.50
MW-5R	11/14/2017	CLS	7.7	410	77	51	1.8	<0.10	<0.02	<0.40	<0.40	<0.10	<0.20	<1.8	-	-	<0.50
MW-5R	2/21/2018	CLS	7.8	400	83	48	1.9	<0.10	<0.02	2.3	<0.40	<0.10	2.6	4.5	-	-	0.61
MW-5R	5/24/2018	CLS	7.8	470	81	44	2.0	<0.10	<0.02	2.2	<0.40	<0.10	2.5	<1.8	-	-	0.68
MW-5R	9/27/18	CLS	7.94	460	100	-	2.1	<0.10	<0.02	2.9	<0.40	<0.10	3	<1.8	-	-	<0.50

Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Total Nitrogen (total) mg/L	Total Coliform	Coliform Bacteria	TTTHM (1) (fecal)	(E. coli) (MPN/100 mL)	Lab (EPA 601) ug/L	Notes
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L		(MPN/100 mL)	(EPA 601)	ug/L			
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100		
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-	-	
MW-5R	12/28/18	CLS	7.97	400	92	44	2	<0.10	<0.02	2.6	<0.40	<0.10	2.7	<1.8	-	-	<0.50		
MW-5R	2/28/19	CLS	7.93	440	63	-	1.5	<0.10	<0.02	1.7	<0.40	<0.10	1.7	63	-	-	<0.50		
MW-5R	6/26/19	CLS	7.66	390	59	52	0.31	0.43	<0.10	0.56	<0.40	<0.10	1.6	<1.8	-	-	280		
MW-6	6/15/2004	STL	7.6	865	143	87.7	5.6	<0.10	-	12.2	<0.05	<0.10	12.2	16.1	<1.1	<1.1	<0.5		
MW-6	3/29/2005	BSK	7.8	870	180	110	6.6	<0.05	<0.01	11	<0.15	<1	11	5.1	<1.1	-	<0.5		
MW-6	6/16/2005	BSK	7.7	910	150	130	5.4	<0.05	<0.01	12	<0.15	<1	12	<1.1	<1.1	-	<0.5		
MW-6	9/29/2005	BSK	7.8	870	150	100	5.2	<0.05	<0.01	11	<0.15	<1	11	<1.1	<1.1	-	<0.5		
MW-6	12/6/2005	BSK	8.1	900	160	110	5.6	<0.05	<0.01	12	<0.05	<1	12	<1.1	<1.1	<1.1	<0.5		
MW-6	2/16/2006	BSK	7.9	900	140	130	4.9	<0.05	<0.01	12	<0.10	<1	12	<1.1	<1.1	-	<0.5		
MW-6	5/16/2006	BSK	8.0	1,000	160	150	5.5	<0.05	<0.01	13	<0.10	<1	13	<1.1	<1.1	-	<0.5		
MW-6	8/21/2006	BSK	7.9	860	140	160	4.7	<0.05	<0.01	13	<0.05	<0.10	-	<1.1	<1.1	-	<0.5		
MW-6	11/20/2006	BSK	-	-	-	-	-	-	-	-	-	-	-	>23.0	<1.1	-	-		
MW-6	2/16/2007																		
MW-6	5/7/2007	BSK	7.9	900	160	120	5.5	<0.05	<0.01	11	<0.05	<1.0	11	16.1	<1.1	-	<0.5		
MW-6	8/29/2007	BSK	7.8	880	130	100	4.5	<0.05	<0.01	9.7	*	<1.0	9.7	<1.1	<1.1	-	<0.5		
MW-6	11/28/2007	BSK	7.8	850	150	96	5.1	<0.05	<0.01	8.7	*	<1.0	8.7	<1.1	<1.1	-	<0.5		
MW-6	2/21/2008	BSK	-	-	-	-	-	-	-	-	-	-	-	<1.1	<1.1	-	-		
MW-6	5/27/2008	CLS	7.1	900	150	130	4.8	<0.10	<0.02	9	<0.10	<0.10	9.1	<1.8	-	-	<0.50		
MW-6	8/27/2008	CLS	7.2	820	150	97	4.6	<0.10	<0.02	8.5	<0.10	0.12	8.6	<1.8	-	-	<0.50		
MW-6	11/24/2008	CLS	7.2	810	140	92	4.3	<0.10	<0.02	8	<0.10	<0.10	8.1	<1.8	-	-	<0.50		
MW-6	2/18/2009	CLS	-	820(5)	140	100	4.3	<0.10	<0.02	7.7	<0.10	<0.10	8.0	<1.8	-	-	<0.50		
MW-6	5/21/2009	CLS	7.2	880	140	97	4.3	<0.10	<0.02	7.9	<0.10	<0.10	7.9	<1.8	-	-	<0.50		
MW-6	8/4/2009	CLS	7.1	860	120	95	3.9	<0.10	<0.02	7.8	<0.10	<0.10	7.8	<1.8	-	-	<0.50		
MW-6	11/5/2009	CLS	-	750(5)	150	89	4.4	<0.10	<0.02	7	<0.10	<0.10	7.2	4.5	-	-	<0.50		
MW-6	2/8/2010	CLS	7.2	850	170	96	5.0	<0.10	<0.02	7.1	<0.10	<0.10	7.4	<1.8	-	-	<0.50		
MW-6	5/7/2010	CLS	7.1	910	160	120	4.6	<0.10	<0.02	7.5	<0.10	<0.10	7.7	<1.8	-	-	<0.50		
MW-6	8/18/2010	CLS	7.0	930	180	120	4.9	<0.10	<0.02	8	<0.10	<0.10	8.3	<1.8	-	-	<0.50		
MW-6	11/2/2010	CLS	7.2	930	180	110	4.8	<0.10	<0.02	7.7	<0.10	<0.10	7.9	1.8	-	-	<0.50		
MW-6	2/23/2011	CLS	7.2	920	160	120	4.8	<0.10	<0.02	7.5	<0.10	<0.10	8.0	2.0	-	-	<0.50		
MW-6	5/5/2011	CLS	7.1	990	150	200	4.1	<0.10	<0.02	4.3	<0.10	<0.10	4.5	<1.8	-	-	<0.50		
MW-6	8/16/2011	CLS	7.2	1100	160	200	4.5	<0.10	<0.02	9.9	<0.10	<0.10	9.9	<1.8	-	-	<0.50		
MW-6	11/8/2011	CLS	7.0	990	160	140	4.6	<0.10	<0.02	8	<0.10	<0.10	8.2	<1.8	-	-	<0.50		
MW-6	2/27/2012	CLS	7.1	880	180	120	5.4	<0.10	<0.02	8.5	<0.10	0.13	8.5	<1.8	-	-	<0.50		
MW-6	5/21/2012	CLS	7.2	870	160	120	5.8	<0.11	<0.02	8.6	<0.10	0.18	8.8	<1.8	-	-	<0.50		
MW-6	8/9/2012	CLS	7.5	970	130	110	3.9	<0.10	<0.02	8.5	<0.10	0.11	8.8	<1.8	-	-	<0.50		
MW-6	11/19/2012	CLS	7.1	950	170	100	5.1	<0.10	<0.02	8.1	<0.10	<0.10	8.3	<1.8	-	-	<0.50		
MW-6	2/21/2013	CLS	6.9	900	160	110	5.3	<0.10	<0.02	7.9	<0.10	0.11	7.9	<1.8	-	-	<0.50		
MW-6	5/15/2013	CLS	7.0	890	160	120	5.1	<0.10	<0.02	8.9	<0.10	0.18	9.0	<1.8	-	-	<0.50		
MW-6	8/15/2013	CLS	7.1	890	150	110	5.0	<0.10	<0.02	8.9	<0.10	<0.10	9.3	<1.8	-	-	<0.50		
MW-6	11/7/2013	CLS	7.0	850	180	110	3.6	<0.10	<0.02	8.8	<0.10	0.18	9.0	<1.8	-	-	<0.50		
MW-6	2/25/2014	CLS	7.2	910	140	100	5.4	<0.10	<0.02	8.4	<0.10	<0.10	8.6	<1.8	-	-	<0.50		
MW-6	5/22/2014	CLS	7.1	880	150	93	5.3	<0.10	<0.02	8.5	<0.10	<0.10	8.8	<1.8	-	-	<0.50		
MW-6	8/27/2014	CLS																	
MW-6	11/12/2014	CLS																	
MW-6	2/26/2015	CLS	7.1	850	140	94	5.2	1.0	0.04	8.3	<0.10	<0.10	8.4	<1.8	-	-	<0.50		
MW-6	5/13/2015	CLS	7.2	860	130	87	4.8	<0.10	<0.02	8.5	<0.10	<0.10	8.6	<1.8	-	-	<0.50		
MW-6	8/4/2015	CLS	7.3	810	140	90	4.6	<0.10	<0.02	7.7	<0.10	<0.10	7.9	<1.8	-	-	<0.50		
MW-6	11/5/2015	CLS	7.2	830	160	81	5.0	<0.10	<0.02	8.5	<0.10	<0.10	8.6	<1.8	-	-	<0.50		
MW-6	2/4/2016	CLS	7.2	810	140	82	4.7	<0.10	<0.02	8.9	<0.40	<0.10	9.0	<1.8	-	-	<0.50		
MW-6	6/30/2016	CLS	7.1	780	120	87	4.3	<0.10	<0.02	8.5	<0.40	<0.10	8.5	<1.8	-	-	0.80		
MW-6	8/25/2016	CLS	7.1	730	150	86	4.3	<0.10	<0.02	8.5	<0.40	<0.10	8.5	<1.8	-	-	3.3		
MW-6	11/17/2016	CLS	7.3	760	140	86	4.2	<0.10	<0.02	9	<0.40	0.11	9.2	<1.8	-	-	<0.50		
MW-6	3/7/2017	CLS	7.1	1000	150	260	3.8	<0.10	<0.02	11	<0.40	0.11	11.0	<1.8	-	-	<0.50		
MW-6	6/27/2017	CLS	6.9	910	150	190	3.8	<0.10	<0.02	9.9	<0.40	0.18	10.0	14	-	-	<0.50		
MW-6	8/23/2017	CLS	7.2	920	150	160	4.2	<0.10	<0.02	11	<0.40	0.16	11.0	<1.8	-	-	<0.50		
MW-6	11/14/2017	CLS	7.0	880	150	130	4.3	<0.10	<0.02	12	<0.40	<0.10	12	<1.8	-	-	<0.50		
MW-6	2/21/2018	CLS	7.1	920	150	120	4.6	<0.10	<0.02	14	<0.40	<0.10	14	4.5	-	-	<0.50		
MW-6	5/24/2018	CLS	7.1	950	140	120	4.8	<0.10	<0.02	14	<0.40	<0.10	14	<1.8	-	-	0.8		
MW-6	9/27/18	CLS	7.09	930	160	-	5.0	<0.10	<0.02	14	<0.40	<0.10	14	2.0	-	-	1.4		



Sampling Point	Sample Date	Lab	pH	TDS	Na (d)	Cl	B (d)	Fe (d)	Mn (d)	NO3-N	NO2-N	NH3-N	Nitrogen (total)	Total Coliform	Bacteria	TTHM (1) (E. coli)	(MPN/100 mL) (EPA 601)	Lab Notes
			Std Unit	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	mg/L	(MPN/100 mL)	(ug/L)			
Recommended Interim Limitation <sup>2</sup>	WO Objective		6.5-8.5	450	69	106	0.6	0.3	0.05	10	1	0.5	10	ND	ND	ND	100	
	Background		7.6	1100	155	138	-	<0.1	0.64	18	-	0.5	-	<2.0	<2.0	-	-	-
	MW-7	12/28/18	CLS										No sample retrieved					
MW-7	12/28/18	CLS	7.22	660	63	-	1.5	<0.10	<0.02	4.8	<0.40	<0.10	4.8	2			<0.50	
MW-7	6/26/19	CLS	7.36	560	86	70	1.5	0.91	0.16	3.2	<0.40	<0.10	3.3	<1.8	-	-	1.3	

### Laboratory Notes:

STL = Severn Trent Laboratory of West Sacramento, CA; BSK = BSK Laboratories of Fresno, CA; TDS = total dissolved solids; NO3-N = nitrate as nitrogen; NO2-N = nitrite as nitrogen;

NH3-N = ammonia as nitrogen; (d) = dissolved fraction; TTHM = total trihalomethanes; nd = nondetect

*italic font style* = Analysis for magnesium, total Kjeldahl nitrogen, fecal coliform and E. coli organisms is not required by RWQCB Order R5-2002-0077.

1 = Total trihalomethanes consist of the sum of bromodichloromethane, bromoform, chloroform, and dibromochloromethane.

2 = See WDRs Item E. 1. Ground Water Limitations; WQ Objective = a variety of applicable regional water quality goals compiled by RWQCB staff; Background = Tolerance Limit (calculated from August 2001 borings and monitoring wells MW-1 and MW-5R)

3 (in Lab Notes column) = Chloroform detection; this compound was also detected in the laboratory method blank; this compound is a common laboratory contaminant.

4 = Nitrate (as nitrogen) laboratory result for 5/7/2007 at MW-4 is reported as shown on the laboratory report although the concentration is about four times higher than historic results. It is probable that the concentration was reported for nitrate (as nitrate). Due to the age of the sample, laboratory validation of the result could not be performed.

5 = Sample was extracted/analyzed outside the EPA recommended holding time

6 = Measured in the field

7 = Calculated using field Electrical Conductivity measurement

\* = Nitrate as nitrogen and Nitrite as Nitrogen results were combined as one

- = Sample not collected or not measured for this constituent

Notes on Laboratory Data depicted on Figures.

1. MW-7 – Data for NO3, and TN for 5/7/2007 is not graphed due to concerns with data.
2. MW-5R – Data for Chloride for 6/27/2017 is suspect (dilution factor?) but is shown on graph.
3. Data reported as less than the laboratory reporting limit is shown on figures as "zero"

**Table 5**  
**Quality Assurance/Quality Control Samples**  
**Wild Wings Water Recycling Facility, Yolo County, CA**


Sampling Point	Sample Date	Lab	TTHM <sup>1</sup> (ug/L)	Lab Notes
EB-1	11/17/2017	CLS	1.1	-
	3/7/2017	CLS	2.0	-
Trip Blanks	11/17/2017	CLS	<0.50	-
	3/7/2017	CLS	<0.50	-
	6/28/2017	CLS	<0.50	-
	8/23/2017	CLS	<0.50	-
	2/21/2018	CLS	<0.50	-
	5/24/2018	CLS	<0.50	Mislabeled 3
	9/27/2018	CLS	<0.50	-
	2/28/2019	CLS	<0.50	-
	6/19/2019	CLS	<0.50	

TTHM = total trihalomethanes; nd = nondetect

1 = Total trihalomethanes consists of the sum of bromodichloromethane, bromoform, chloroform, and dibromocholoromethane

# **CHARTS**

Chart 1  
Water Levels 2004-19

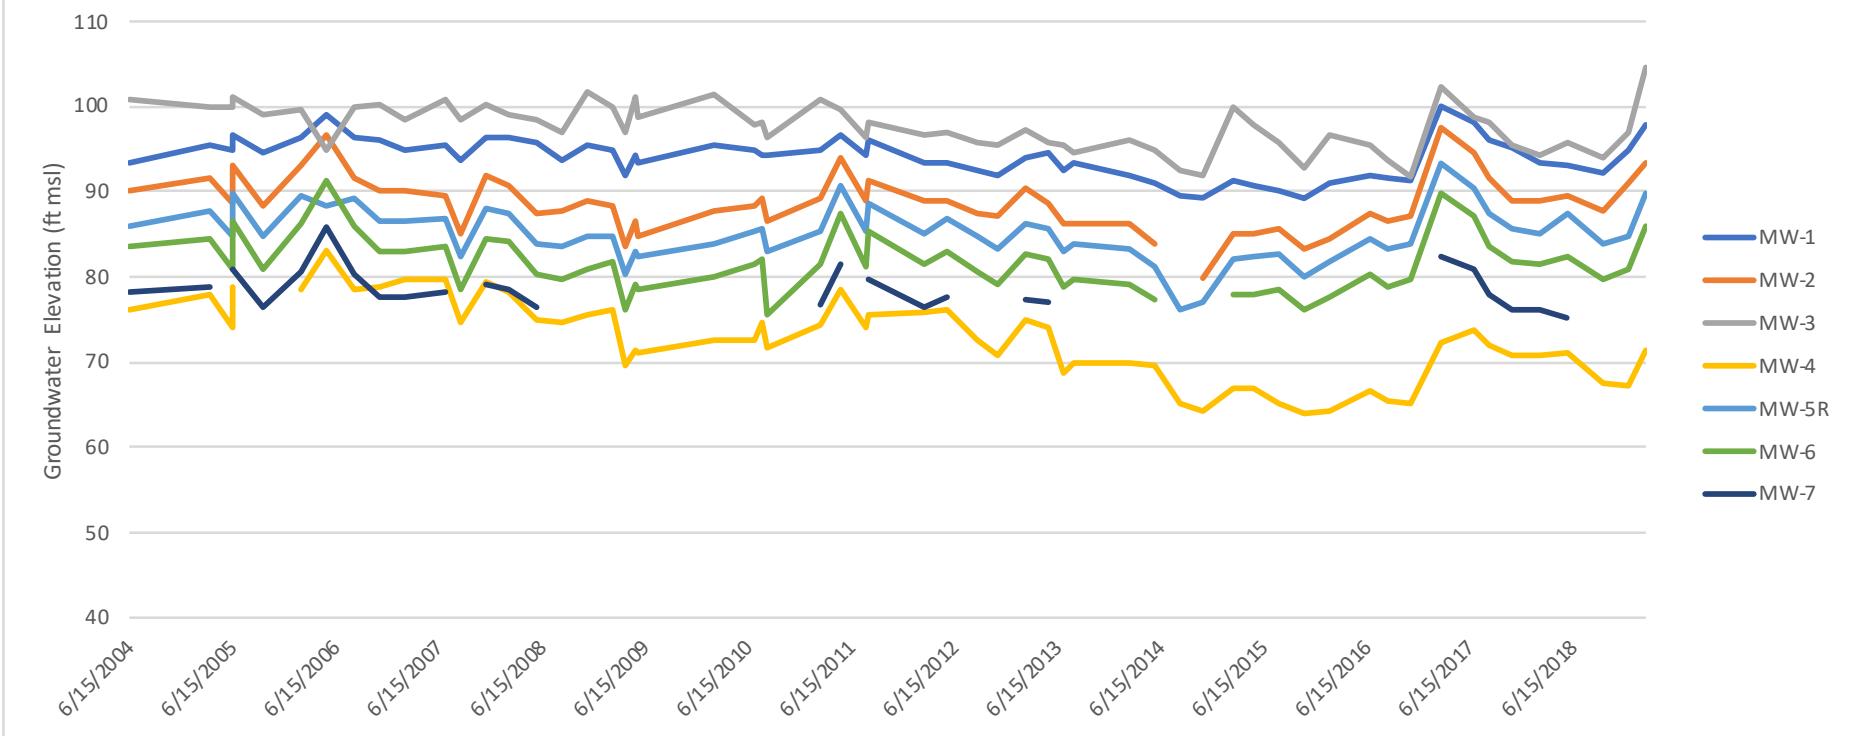

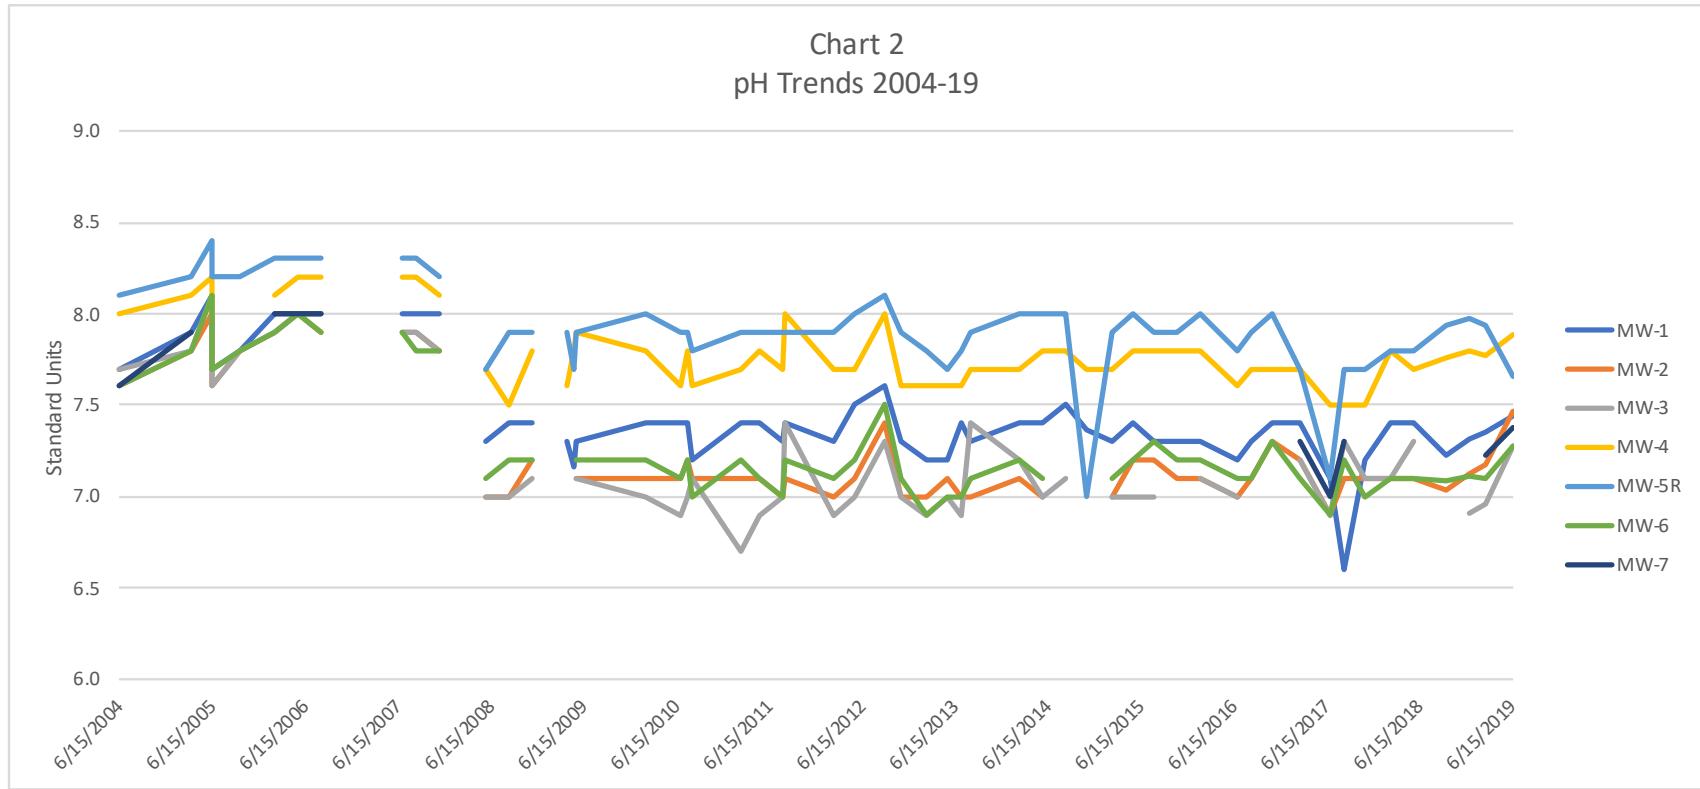


Chart 3  
TDS Trends 2004-19

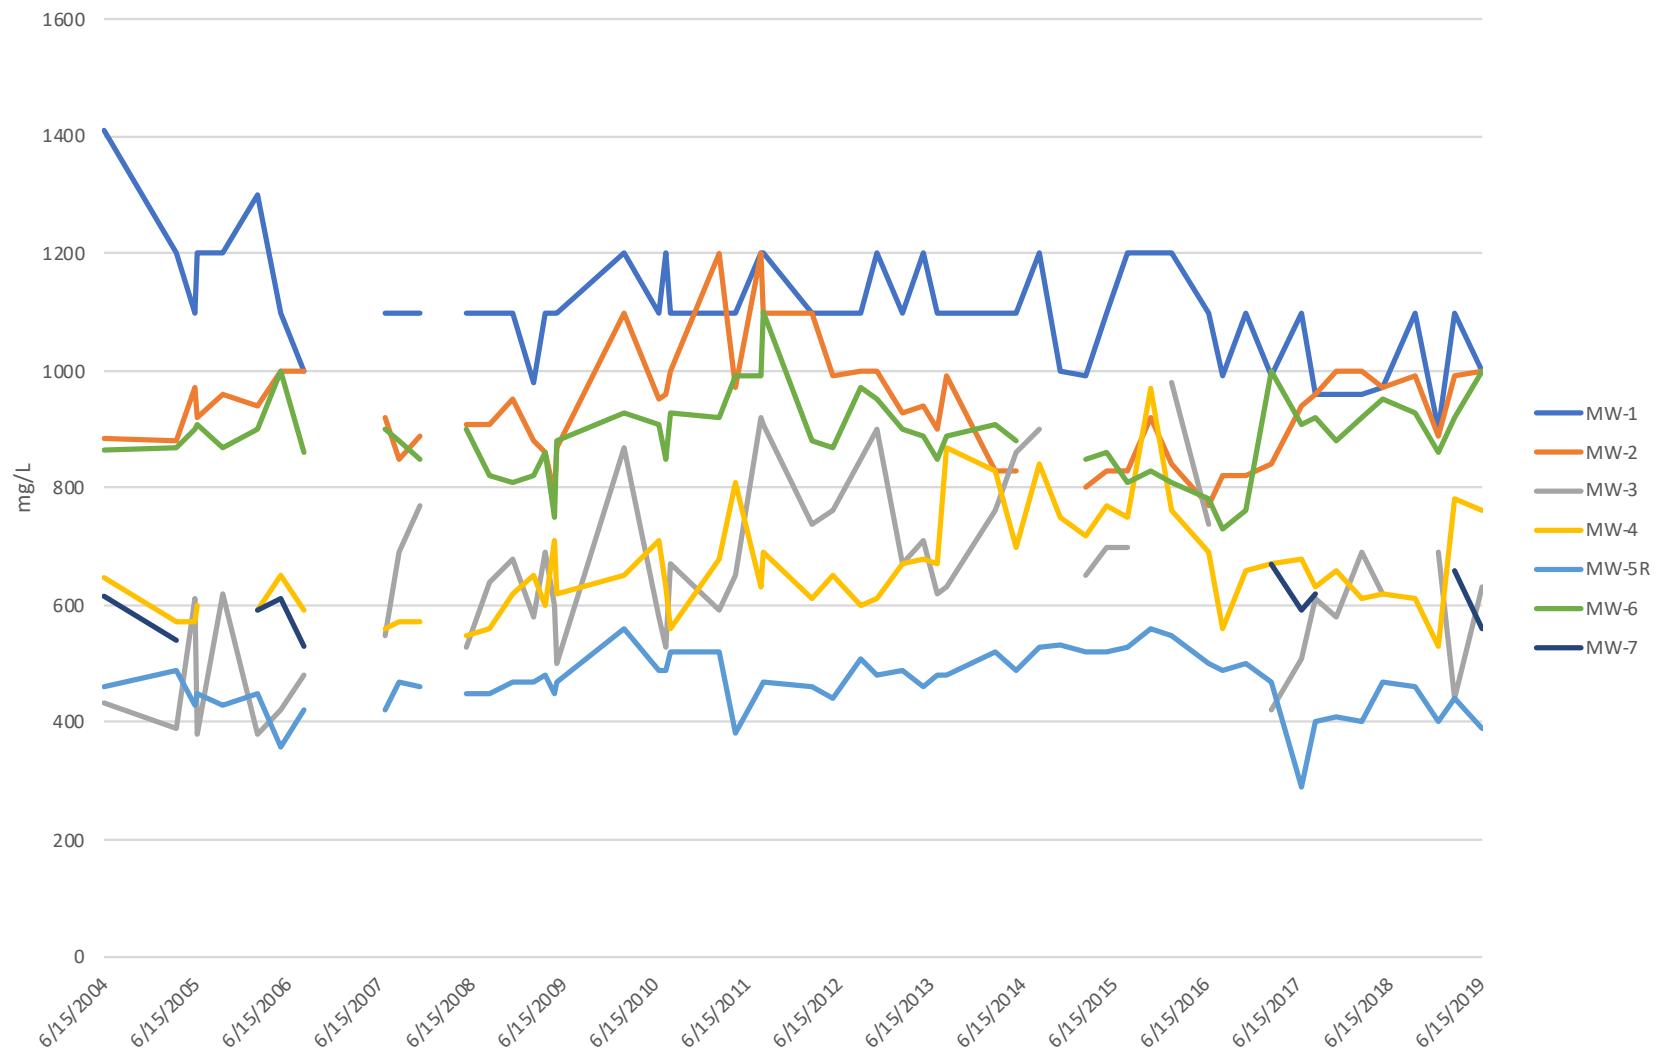


Chart 4  
Na Trends 2004-19

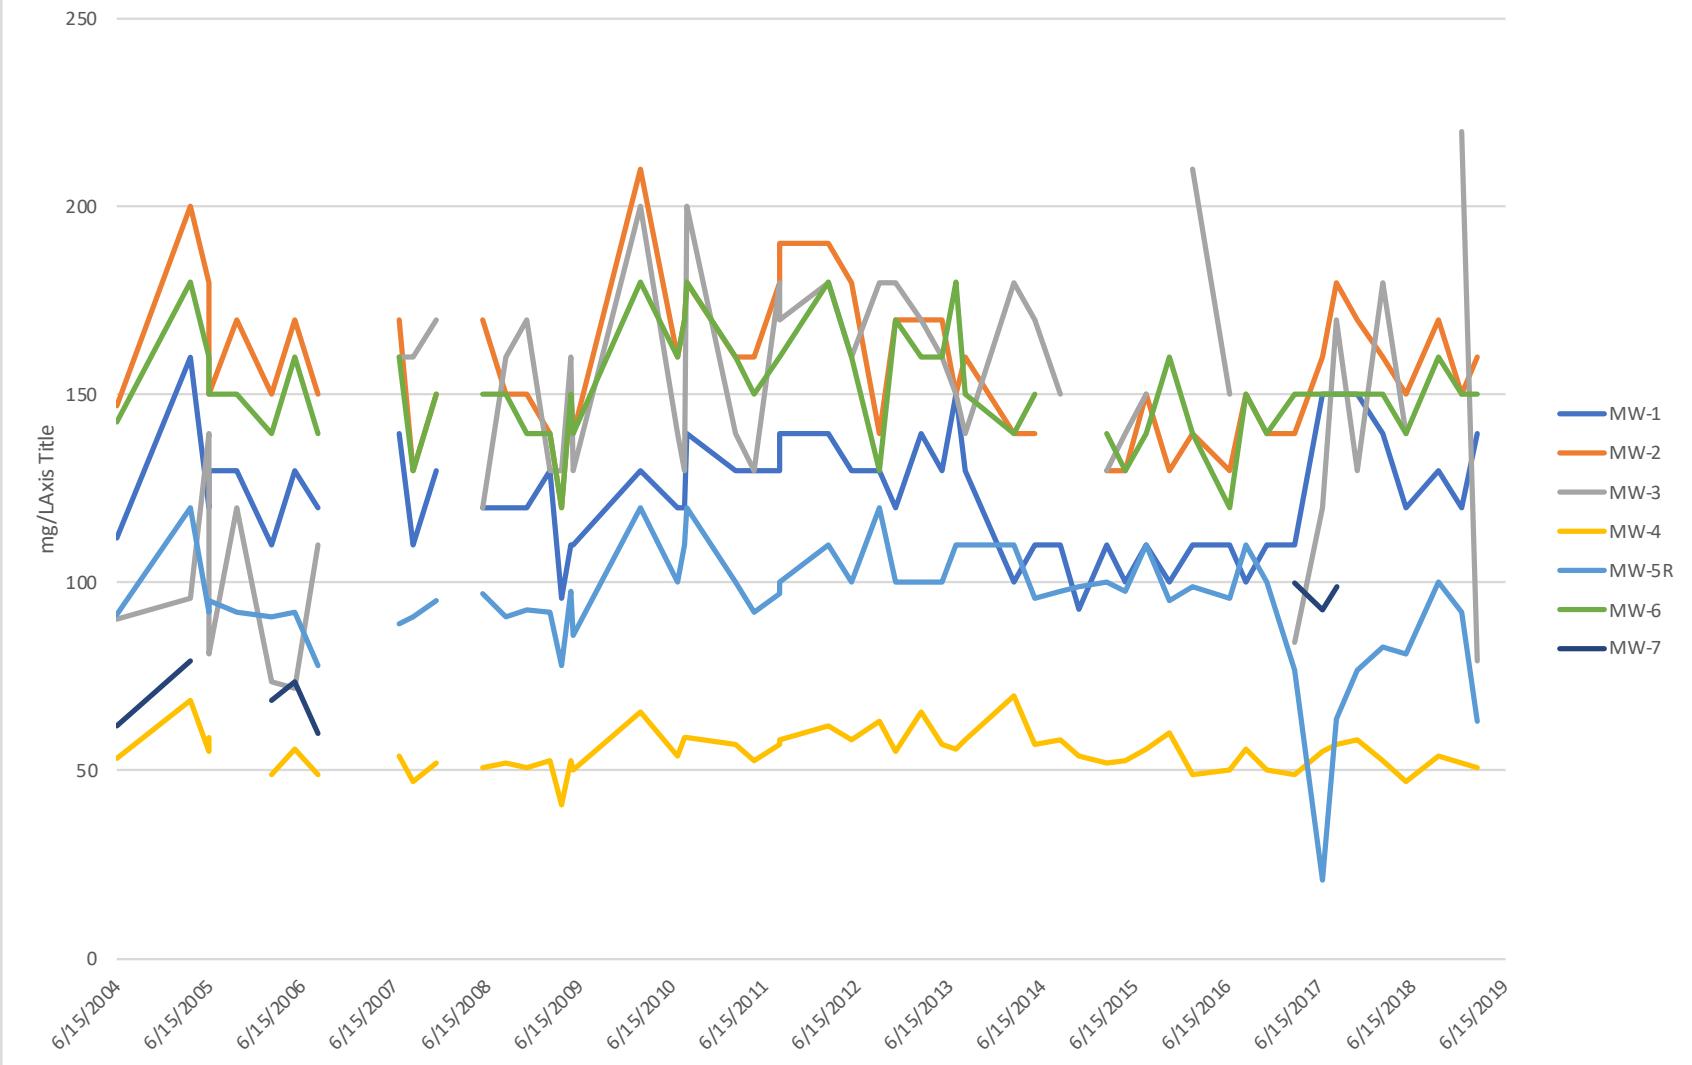


Chart 5  
Cl Trends 2004-19

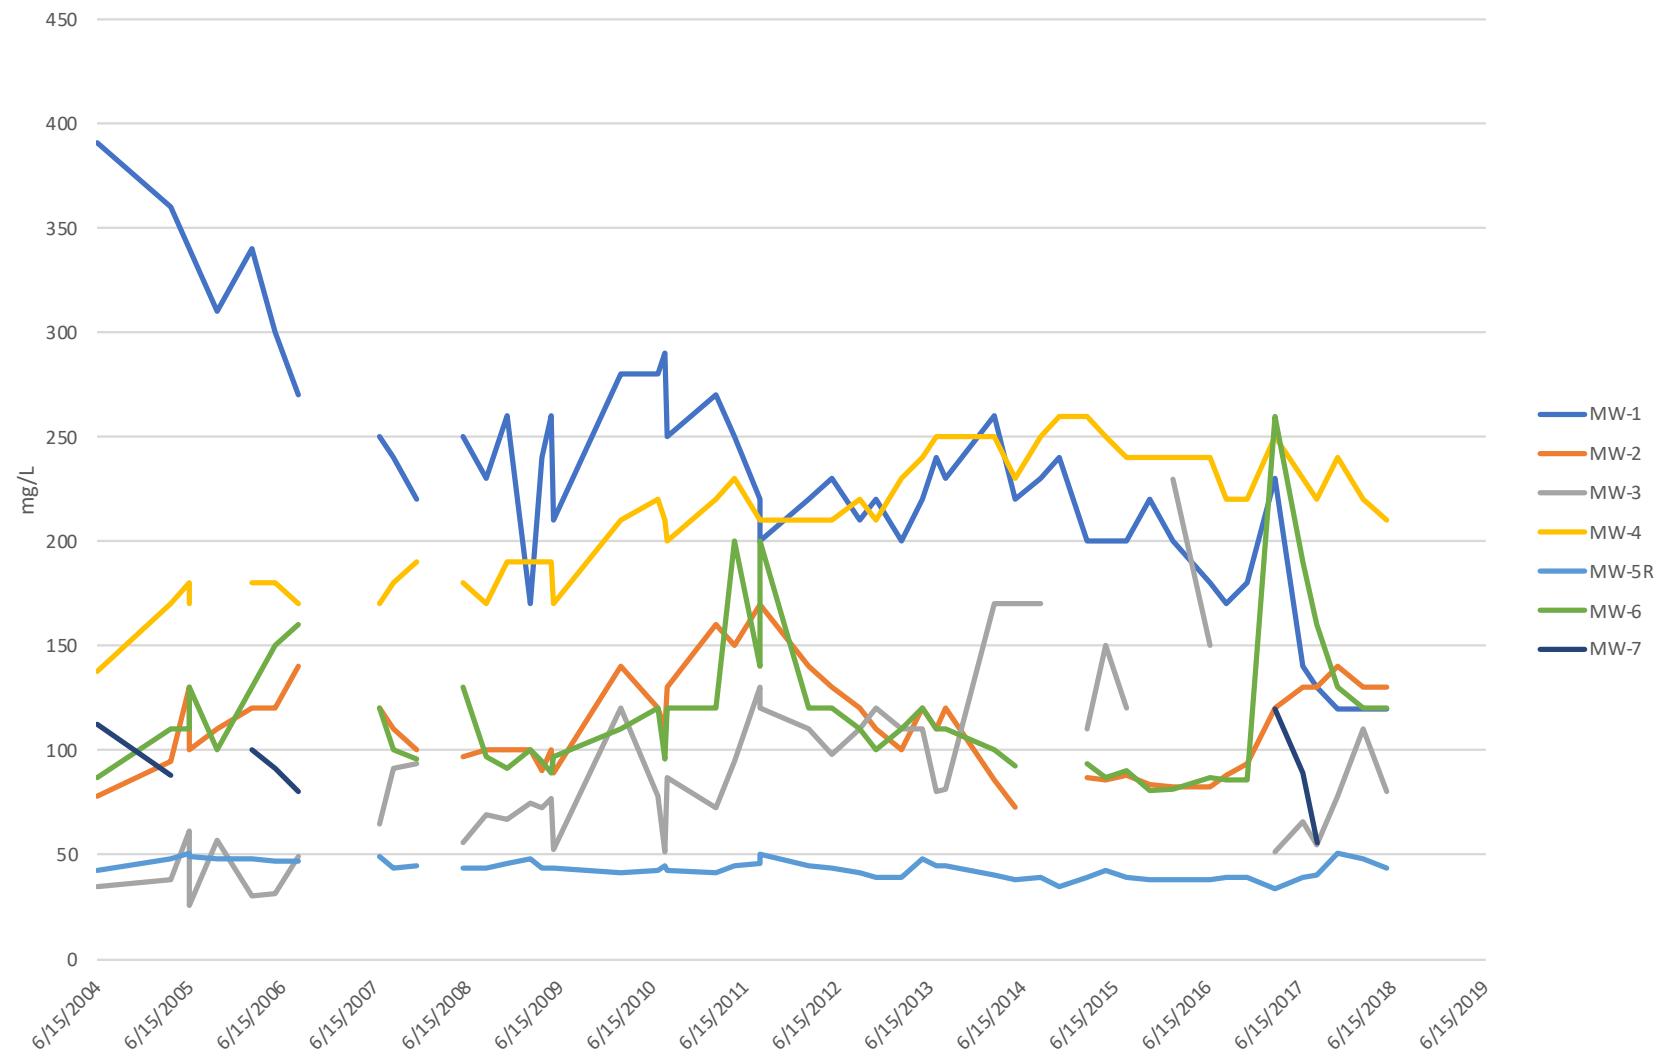


Chart 6  
B Trends 2004-19

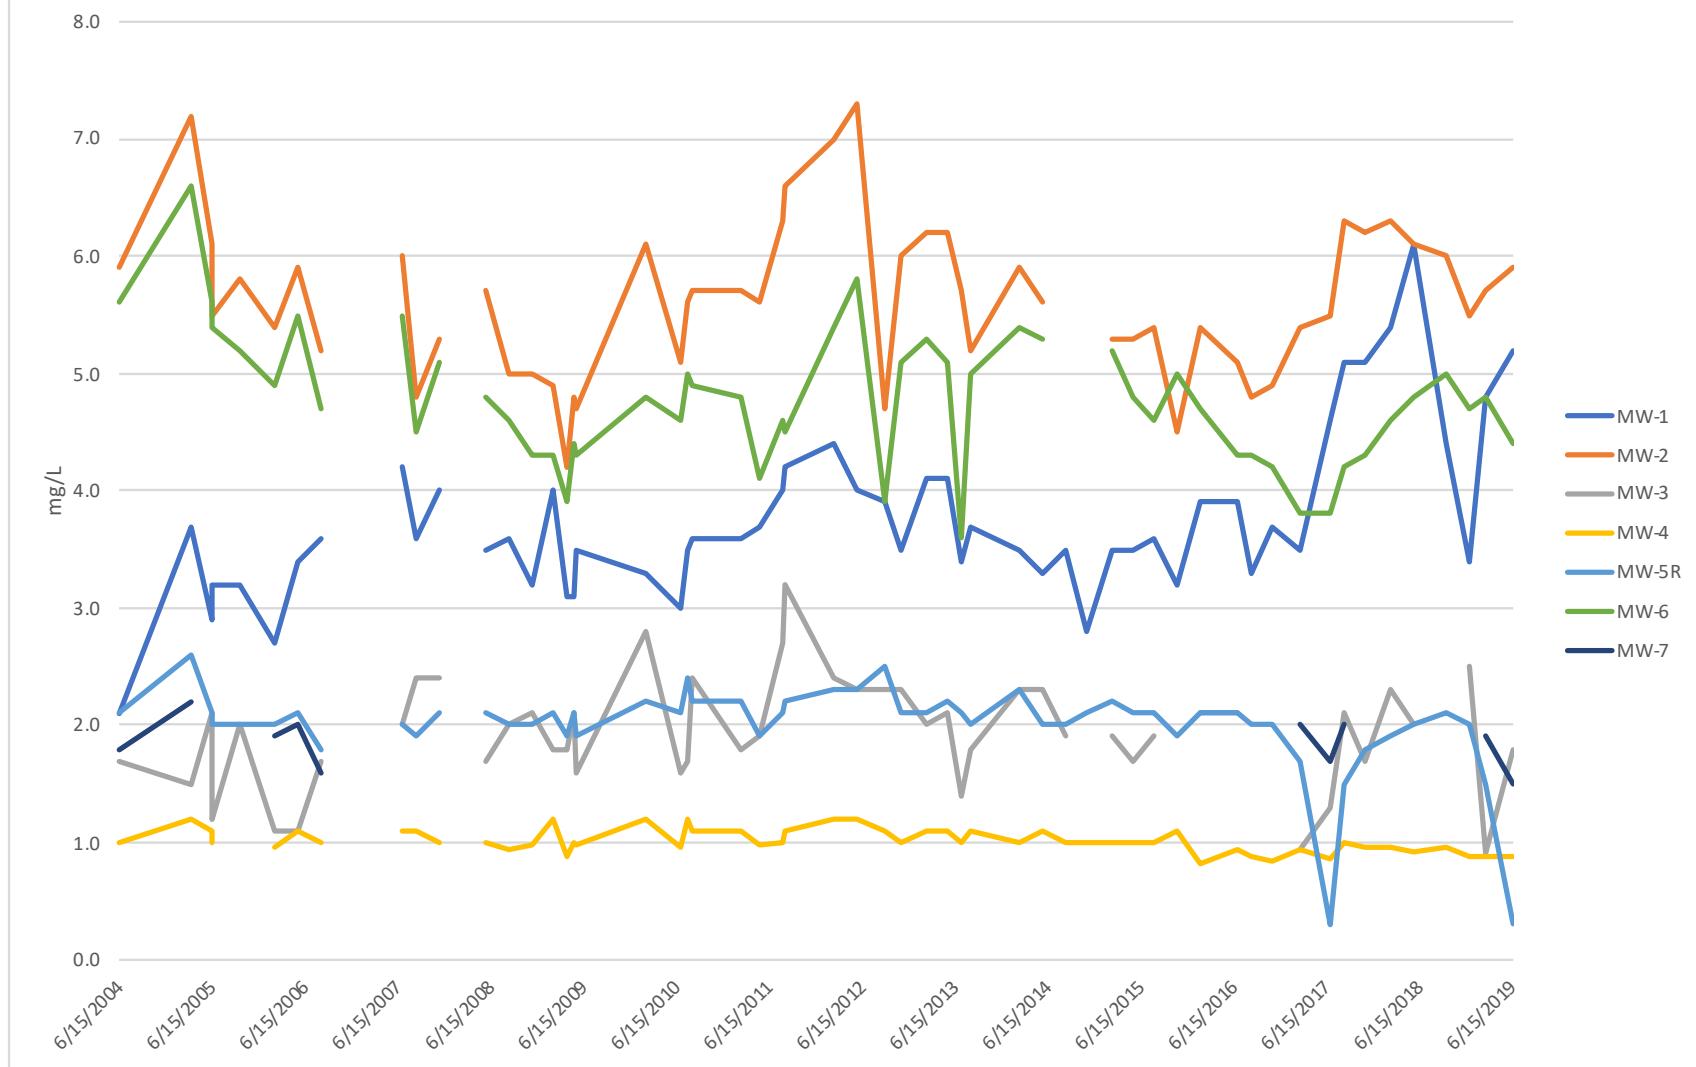


Chart 7  
Nitrate, as N Trends 2004-19


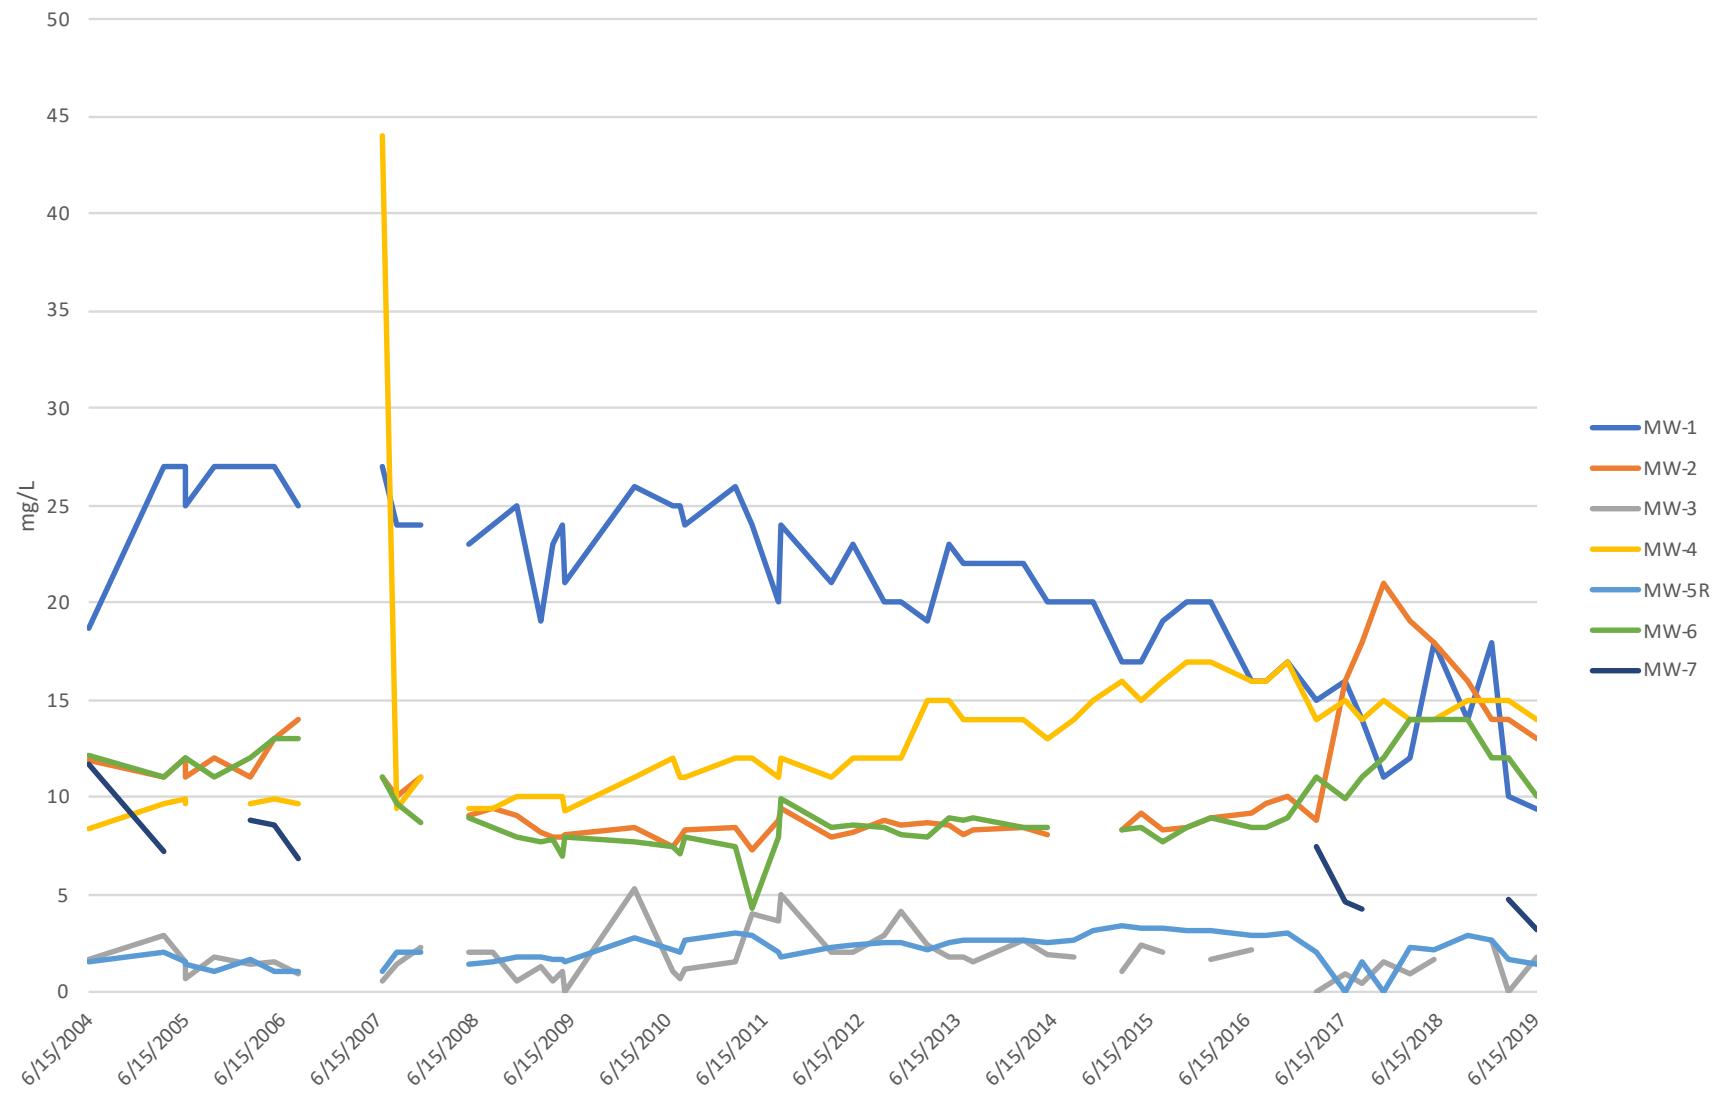


Chart 8  
Total Nitrogen Trends 2004-19



## **APPENDIX A**

## **FIELD DATA FORMS**

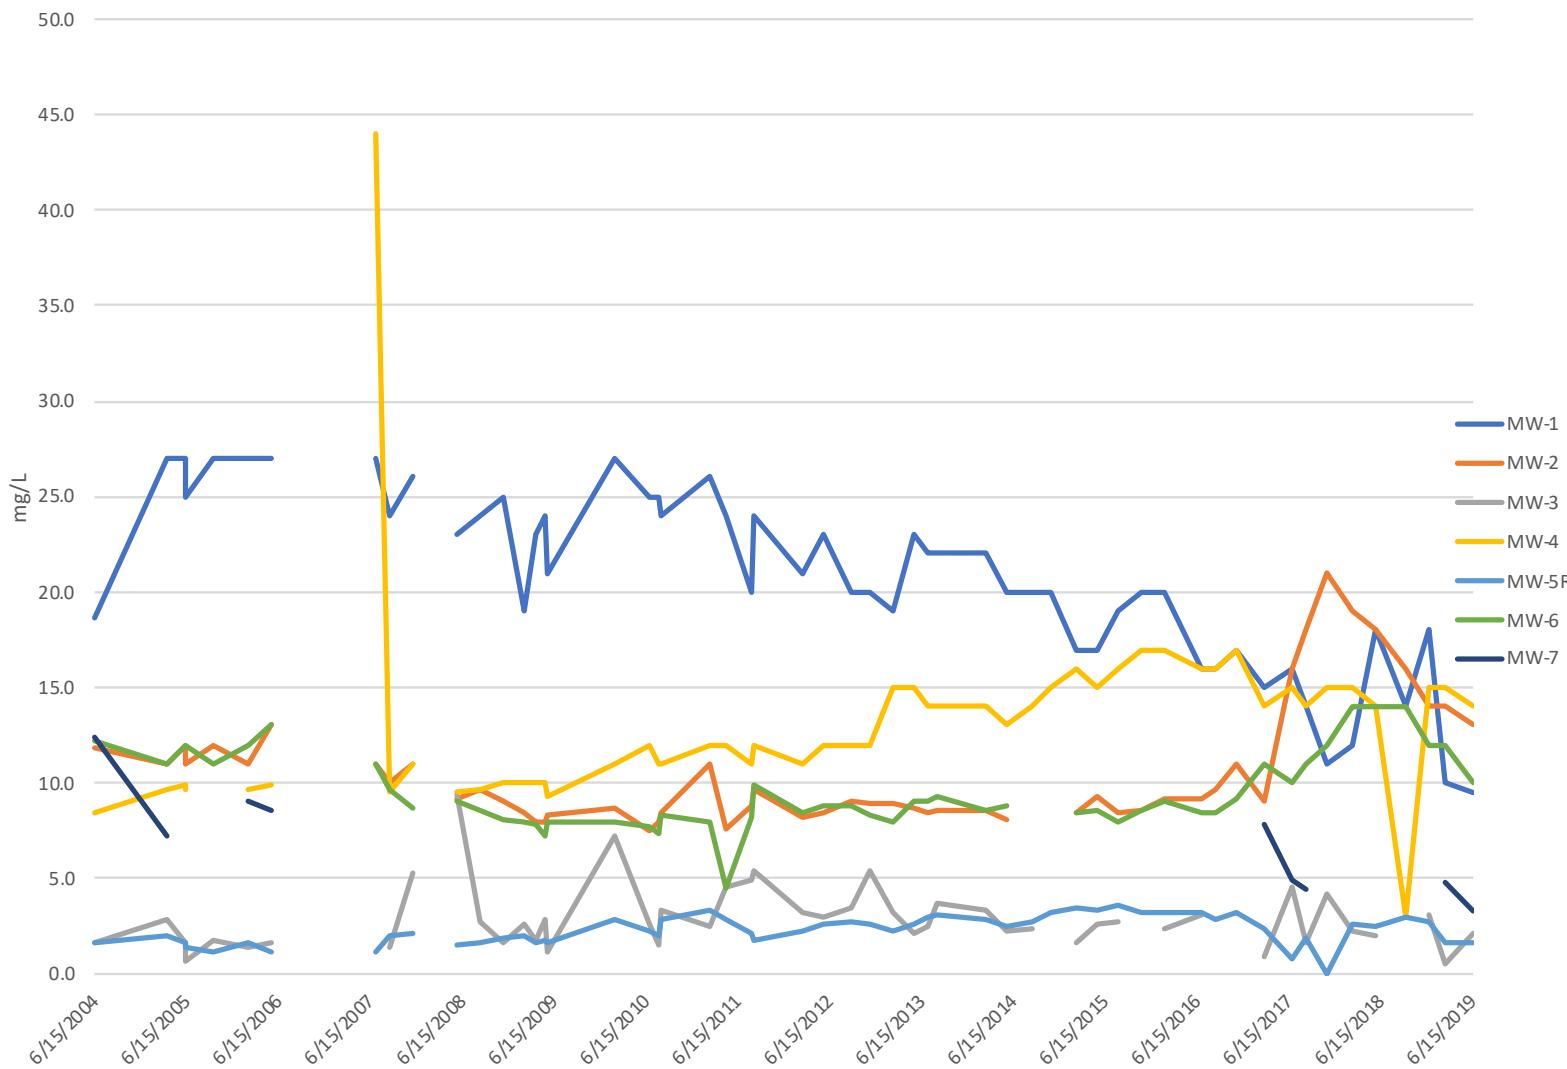

**HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE**

List of Analytes and Methods

Analyte	Method	MRL
Ammonia, as N	SM4500-NH3F-1997	0.10 mg/L
Nitrate, as N	EPA Method 300.0	0.40 mg/L
Nitrite, as N	EPA Method 300.0	0.40 mg/L
Total Kjeldahl Nitrogen	SM4500-NH3F-1997	0.20 mg/L
Total Nitrogen	EPA Methods 351.3/300.0	0.40 mg/L
Chloride	EPA Method 300.0	2.5 mg/L
pH	SM4500-H B	0.01 pH Units
Total Dissolved Solids	SM2540C	10 mg/L
Boron	EPA Method 200.7	50 µg/L
Total Iron	EPA Method 200.7	100 µg/L
Total Manganese	EPA Method 200.7	20 µg/L
Sodium	EPA Method 200.7	1000 µg/L
Total Coliform	SM 9221	1.8 MPN/100 mL
Trihalomethanes*	EPA Method 524.2	0.5 µg/L

\*Trihalomethanes to include Bromodichloromethane, Bromoform, Chloroform, Dibromochloromethane and Total Trihalomethanes (THM).

Attachments:

1. Wild Wings site map showing groundwater monitoring wells
2. Example laboratory chain of custody



HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE

## CHAIN OF CUSTODY

CLS ID No.: \_\_\_\_\_

LOG # 3 201713

NAME AND ADDRESS

REPORT TO:

CLIENT JOB NUMBER

ANALYSIS REQUESTED

123 Main Street Blvd

Project Manager Name: S. G. C. P.

CLS (916) 638-7301  
3248 FITZGERALD RD.  
PANCHO CORDOVA, CA  
95742

GEOTRACKER:  
EDF REPORT  
GLOBAL ID:

CDPH WRITE ON EDT TRANSMISSION?

STATE SYSTEM NUMBER

IF "YES" PLEASE ENTER THE SOURCE NUMBER(S).

EDT

YES

NO

QUOTE #

P.O. #

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY

DATE / TIME

CONDITONS / COMMENTS

RECEIVED BY (SIGN)

PRINT NAME / COMPANY</p

# GROUNDWATER SAMPLING LOG

Well Number:	<u>MW-1</u>	Samplers Name:	<u>Denton Dusch</u>	Total well depth (ft):	<u>41.40</u>
Date:	<u>6/18/15</u>	Site:	<u>W.M.D. Wells</u>	Well Diameter (in):	<u>2</u>
Gauging Date:	<u>6/18/15</u>	Project Number:	<u>200 Qm G.W.</u>	Borehole Diameter (in):	<u>—</u>
Bailer ID:	<u>Diposable</u>	Static water level (ft):	<u>27.9</u>	Development method:	<u>—</u>
Sample Date:	<u>6/19/15</u>	Previous static water level (ft):	<u>28.39</u>	Purging method:	<u>pump</u>
		Standing water column (ft):	<u>13.49</u>	Sampling method:	<u>Bailer</u>
		* All measurements taken from: <input checked="" type="checkbox"/> Top of casing. <input type="checkbox"/> Protective casing. <input type="checkbox"/> Ground level			
TIME	AMOUNT PURGED (gal)	EC ( $\mu$ S/cm)	pH	TEMP (C)	COMMENTS
12:30	1.25	1720	7.0	29.9	Clean, no odor
12:34	1.0	1814	6.9	25.4	Clean, no odor
12:36	1.5	1790	7.03	22.0	Clean, no odor
12:38	2.0	1801	7.13	23.0	Clean, no odor
12:40	2.5	—	—	—	MISSING READINGS
12:42	3.0	1811	7.21	23.2	Clean, no odor
12:44	3.5	—	—	—	MISSING READINGS
12:46	4.0	1713	7.30	23.9	Clean, no odor
12:50	5.0	1809	7.22	22.6	Clean, no odor
12:54	6.0	1822	7.31	21.8	Clean, no odor
12:58	7.0	1823	7.21	22.0	
<u>6/19/15 - Conditions at sample</u>					$13.49 \times .163 = 2.19 \times 3 = 6.57 \text{ Gal Total}$
Wind:	<u>Clear, warm</u>	Samples			2.8122
# Sun	<u>Face completion (in box.) Vacuumed out, case cleaned</u>				
NEW	<u>REK pump on place installing.</u>				

Volume per Foot for 2" Well = 0.1632 gal/foot

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

# GROUNDWATER SAMPLING LOG

## GROUNDWATER SAMPLING LOG

**Volume per Foot for 2" Well = 0.1632 gal/foot**

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

# GROUNDWATER SAMPLING LOG

Well Number:	<u>MU-4</u>	Samplers Name:	<u>Darren Docht</u>	Total well depth (ft):	<u>70.30</u>	
Date:	<u>6/19/09</u>	Site:	<u>Wild Water</u>	Well Diameter (in):	<u>2"</u>	
		Project Number:	<u>2nd Qin C.W.</u>	Borehole Diameter (in):	<u>2"</u>	
Gauging Date:	<u>6/18/09</u>	Static water level (ft):	<u>44.40</u>	Development method:	<u>—</u>	
Bailer ID:	<u>J. Provoche</u>	Previous static water level (ft):	<u>49.40</u>	Purging method:	<u>Pump</u>	
Sample Date:	<u>6/19/09</u>	Standing water column (ft):	<u>25.9</u>	Sampling method:	<u>Bailer</u>	
* All measurements taken from: <input checked="" type="checkbox"/> Top of casing <input type="checkbox"/> Protective casing <input type="checkbox"/> Ground level						
TIME	AMOUNT PURGED (gal)	EC (µS/cm)	pH	TEMP (°C)	COMMENTS	WATER LEVEL (ft. ags)
0940	.5	12.55	7.40	22.3	Turbid, no odor, no color 0.5cm	
945	2.5	12.80	7.44	22.5		
950	5.0	12.50	7.3	23.0		
952	6.0	12.50	7.3	23.0		
754	7.0	12.54	7.51	21.6	SL Turbid	
352	8.0	12.58	7.74	25.0		
357	9.0	12.62	7.59	20.6		
1000	10.0	12.64	7.60	20.6		
1002	11.0	12.63	7.66	20.3		
1004	12.0	12.63	7.60	20.3	20.9' X .163 = 4.22 Gal Volume	
1006	13.0	12.64	7.61	20.3	12.66 Gal Total Volume	
6/19/09	Sampling				Clean, no odor	
12:00	Sampled				Check air over <u>water</u> & <u>check sample tank</u>	
<u>* Well Dex-Grode Cleaned, Box Vacumed, Cass changed, New Expansion Plug installed</u>						

Volume per foot for 2" Well = 0.1632 gal/foot

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)



## GROUNDWATER SAMPLING LOG

GROUNDWATER SAMPLING LOG					
Well Number:	<u>MW-6</u>		Samplers Name:	<u>Dayton Busch</u>	
Date:	<u>6/18/15</u>		Site:	<u>WinkDwInlets</u>	
Gauging Date:	<u>6/18/15</u>		Project Number:	<u>ZmoQrn G.CJ.</u>	
Bailer ID:	<u>D-1000104</u>		Static water level (ft):	<u>32.69</u>	
Sample Date:	<u>6/19/15</u>		Previous static water level (ft):	<u>35.60</u>	
Standing water column (ft): <u>16.11</u>					
* All measurements taken from: <input checked="" type="checkbox"/> Top of casing, <input type="checkbox"/> Protective casing, <input type="checkbox"/> Ground level					
TIME	AMOUNT PURGED (gal)	EC (µS/cm)	pH	TEMP (°C)	WATER LEVEL (ft bgs)
0745	.25	1735	6.60	21.9	Turbid, no odor
0849	2.0	1748	7.34	21.5	
0951	3.0	1744	7.42	21.6	
0955	4.0	1759	7.25	21.3	Turbid, no odor
0957	5.0	1760	7.17	21.0	Chlorine
0903	6.0	1749	7.19	21.3	Chlor, no color, no odor
0907	7.0	1751	7.11	21.2	
0911	8.0	1763	7.07	21.2	
Total "X": 163 = 2.62 Gal Volume x 3 = 7.86 Gal					
6/19/15	SampBott	Churn, no odor			33.72
1130	SampBott	Churn, no odor			
* <u>Well Box Grnd Churned, Box Vacummed, Case cleaned, everything in trash</u>					

Volume per Foot for 2" Well = 0.1632 gal/foot

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

# GROUNDWATER SAMPLING LOG

Volume per Foot for 2" Well = 0.1632 gal/foot

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

# GROUNDWATER SAMPLING LOG

**Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)**

**Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)**



**HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE**

**CHAIN OF CUSTODY**

CLS ID No.:  
-

LOG  
198320

List of Analytes and Methods

Analyte	Method	MRL
Ammonia, as N	SM4500-NH3F-1997	0.10 mg/L
Nitrate, as N	EPA Method 300.0	0.40 mg/L
Nitrite, as N	EPA Method 300.0	0.40 mg/L
Total Kjeldahl Nitrogen	SM4500-NH3F-1997	0.20 mg/L
Total Nitrogen	EPA Methods 351.3/300.0	0.40 mg/L
Chloride	EPA Method 300.0	2.5 mg/L
pH	SM4500-H B	0.01 pH Units
Total Dissolved Solids	SM2540C	10 mg/L
Boron	EPA Method 200.7	50 µg/L
Total Iron	EPA Method 200.7	100 µg/L
Total Manganese	EPA Method 200.7	20 µg/L
Sodium	EPA Method 200.7	1000 µg/L
Total Coliform	SM 9221	1.8 MPN/100 mL
Trihalomethanes*	EPA Method 524.2	0.5 µg/L

\*Trihalomethanes to include Bromodichloromethane, Bromoform, Chloroform, Dibromochloromethane and Total Trihalomethanes (THM).

Attachments:

1. Wild Wings site map showing groundwater monitoring wells
2. Example laboratory chain of custody

## GROUNDWATER SAMPLING LOG

**HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE**



**CHAIN OF CUSTODY**

CLSID No.:

LOG 19/5/96

List of Analytes and Methods

Analyte	Method	MRL
Ammonia, as N	SM4500-NH3F-1997	0.10 mg/L
Nitrate, as N	EPA Method 300.0	0.40 mg/L
Nitrite, as N	EPA Method 300.0	0.40 mg/L
Total Kjeldahl Nitrogen	SM4500-NH3F-1997	0.20 mg/L
Total Nitrogen	EPA Methods 351.3/300.0	0.40 mg/L
Chloride	EPA Method 300.0	2.5 mg/L
pH	SM4500-H B	0.01 pH Units
Total Dissolved Solids	SM2540C	10 mg/L
Boron	EPA Method 200.7	50 µg/L
Total Iron	EPA Method 200.7	100 µg/L
Total Manganese	EPA Method 200.7	20 µg/L
Sodium	EPA Method 200.7	1000 µg/L
Total Coliform	SM 9221	1.8 MPN/100 mL
Trihalomethanes*	EPA Method 524.2	0.5 µg/L

\*Trihalomethanes to include Bromodichloromethane, Bromoform, Chloroform, Dibromochloromethane and Total Trihalomethanes (THM).

Attachments:

1. Wild Wings site map showing groundwater monitoring wells
2. Example laboratory chain of custody

## GROUNDWATER SAMPLING LOG

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

Casing Volume = Standing Water Column \* 0.1632 gal/foot (multiply by 3 to get purge volume)

# HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE



## CHAIN OF CUSTODY

CLS ID No.: \_\_\_\_\_

LOG # 201708

**REPORT TO:** \_\_\_\_\_

CLIENT JOB NUMBER

**ANALYSIS REQUESTED**

NAME AND ADDRESS

1234 W. Main St., Suite 100

DESTINATION LABORATORY

CLS (916) 638-7301

3249 FITZGERALD RD.

RANCHO CORDOVA, CA.

95742

OTHER

GEOTRACKER:  
EDT REPORT

GLOBAL ID:  YES  NO

PROJECT MANAGER

John Doe, SPC, CLP

PRESERVATIVES

SAMPLED BY: *John Doe*  
JOB DESCRIPTION: *Soil QIR Survey*

DATE

TIME

IDENTIFICATION

MATRIX

NO.

CONTAINER

TYPE

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

56

57

58

59

60

61

62

63

64

65

66

67

68

69

70

71

72

73

74

75

76

77

78

79

80

81

82

83

84

85

86

87

88

89

90

91

92

93

94

95

96

97

98

99

100

101

102

103

104

105

106

107

108

109

110

111

112

113

114

115

116

117

118

119

120

121

122

123

124

125

126

127

128

129

130

131

132

133

134

135

136

137

138

139

140

141

142

143

144

145

146

147

148

149

150

151

152

153

154

155

156

157

158

159

160

161

162

163

164

165

166

167

168

169

170

171

172

173

174

175

176

177

178

179

180

181

182

183

184

185

186

187

188

189

190

191

192

193

194

195

196

197

198

199

200

201

202

203

204

205

206

207

208

209

210

211

212

213

214

215

216

217

218

219

220

221

222

223

224

225

226

227

228

229

230

231

232

233

234

235

236

237

238

239

240

241

242

243

244

245

246

247

248

249

250

251

252

253

254

255

256

257

258

259

260

261

262

263

264

265

266

List of Analytes and Methods

Analyte	Method	MRL
Ammonia, as N	SM4500-NH3F-1997	0.10 mg/L
Nitrate, as N	EPA Method 300.0	0.40 mg/L
Nitrite, as N	EPA Method 300.0	0.40 mg/L
Total Kjeldahl Nitrogen	SM4500-NH3F-1997	0.20 mg/L
Total Nitrogen	EPA Methods 351.3/300.0	0.40 mg/L
Chloride	EPA Method 300.0	2.5 mg/L
pH	SM4500-H B	0.01 pH Units
Total Dissolved Solids	SM2540C	10 mg/L
Boron	EPA Method 200.7	50 µg/L
Total Iron	EPA Method 200.7	100 µg/L
Total Manganese	EPA Method 200.7	20 µg/L
Sodium	EPA Method 200.7	1000 µg/L
Total Coliform	SM 9221	1.8 MPN/100 mL
Trihalomethanes*	EPA Method 524.2	0.5 µg/L

\*Trihalomethanes to include Bromodichloromethane, Bromoform, Chloroform, Dibromochloromethane and Total Trihalomethanes (THM).

Attachments:

1. Wild Wings site map showing groundwater monitoring wells
2. Example laboratory chain of custody

**APPENDIX B**  
**LABORATORY ANALYTICAL RESULTS**  
**&**  
**CHAIN OF CUSTODY**



## CALIFORNIA LABORATORY SERVICES

*Committed. Responsive. Flexible.*

June 26, 2019

CLS Work Order #: 19F1131

COC #: 201713

Dan Demoss  
California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

**Project Name: Wild Wings**

Enclosed are the results of analyses for samples received by the laboratory on 06/19/19 16:48. Samples were analyzed pursuant to client request utilizing EPA or other ELAP approved methodologies. I certify that the results are in compliance both technically and for completeness.

Analytical results are attached to this letter. Please call if we can provide additional assistance.

Sincerely,

James Liang, Ph.D.  
Laboratory Director

CA SWRCB ELAP Accreditation/Registration number 1233



CALIFORNIA  
LABORATORY  
SERVICES  
Qualified by State, Public

### CHAIN OF CUSTODY

CLS ID No.: 19F113

LOG No. 201713

HIGHLIGHTED AREAS MUST BE FILLED OUT PRIOR TO ACCEPTANCE

REPORT TO:		CLIENT JOB NUMBER		ANALYSIS REQUESTED		GEOTRACKER: EDF REPORT <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO GLOBAL ID: _____				
NAME AND ADDRESS <b>CHWA</b> 1234 N. MARKET Blvd SACRAMENTO, CA		DESTINATION LABORATORY <input checked="" type="checkbox"/> CLS (916) 638-7301 3240 FITZGERALD RD. RANCHO CORDOVA, CA 95742 <input type="checkbox"/> OTHER		PRESERVATIVES <input checked="" type="checkbox"/> SEE Attached Table of Analytics <input checked="" type="checkbox"/> To Be Determined		CDPH WRITE ON EDT TRANSMISSION? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO STATE SYSTEM NUMBER _____ IF "YES" PLEASE ENTER THE SOURCE NUMBER(S). <b>SUMMARY: SUNNY, HOT PM BREEZE (AM.) WINDY</b>				
PROJECT MANAGER <b>JAN DEMOSS</b> 916-616-7761										
PROJECT NAME <b>WILD WILDS</b>										
SAMPLED BY <b>DAYTON Bresch</b>										
JOB DESCRIPTION <b>2nd QTR C.W.</b>										
SITE LOCATION										
DATE	TIME	SAMPLE IDENTIFICATION	MATRIX	CONTAINER NO.	TYPE	TURN AROUND TIME		SPECIAL INSTRUCTIONS		
6/19/19	1320	mw-1	GW	8		- DAY	2 DAY	3 DAY	5 DAY	OR
(	1430	mw-2	GW	8						ALT. ID: <b>LAB TO FILTER Samples</b>
↓	1220	mw-3	GW	8						
6/19/19	1200	mw-4	GW	8						
(	1400	mw-5R	GW	8						
↓	1130	mw-6	GW	8						
↓	1100	mw-7	GW	8		X X X	X X X	X X X	X X X	
6/19/19	1000	Tn.p. BLANK	W	3	VQA					BUBBLES IN 2 or 3
						INVOICE TO:				
						PO. #				
						QUOTE #				
Email/Address						PRESERVATIVES:	(1) HCl (2) HNO <sub>3</sub>	(3) - COLD (4) - NaOH	(5) - H <sub>2</sub> SO <sub>4</sub> (6) - Na <sub>2</sub> SO <sub>4</sub>	(7) -
RELINQUISHED BY (SIGN)		PRINT NAME / COMPANY		DATE / TIME		RECEIVED BY (SIGN)		PRINT NAME / COMPANY		
<i>Dayton Bresch</i>		<i>Dayton Bresch</i>		6/19/19 1648						
RECD AT LAB BY: <i>Me</i>		DATE / TIME: 6/19/19 1448		CONDITIONS / COMMENTS: <i>5.4</i>						
SHIPPED BY: <input type="checkbox"/> FED X <input type="checkbox"/> UPS <input type="checkbox"/> OTHER _____						AIR BILL #				

1AF1131

List of Analytes and Methods

Analyte	Method	MRL
Ammonia, as N	SM4500-NH3F-1997	0.10 mg/L
Nitrate, as N	EPA Method 300.0	0.40 mg/L
Nitrite, as N	EPA Method 300.0	0.40 mg/L
Total Kjeldahl Nitrogen	SM4500-NH3F-1997	0.20 mg/L
Total Nitrogen	EPA Methods 351.3/300.0	0.40 mg/L
Chloride	EPA Method 300.0	2.5 mg/L
pH	SM4500-H B	0.01 pH Units
Total Dissolved Solids	SM2540C	10 mg/L
Boron	EPA Method 200.7	50 µg/L
Total Iron	EPA Method 200.7	100 µg/L
Total Manganese	EPA Method 200.7	20 µg/L
Sodium	EPA Method 200.7	1000 µg/L
Total Coliform	SM 9221	1.8 MPN/100 mL
Trihalomethanes*	EPA Method 524.2	0.5 µg/L

\*Trihalomethanes to include Bromodichloromethane, Bromoform, Chloroform, Dibromochloromethane and Total Trihalomethanes (THM).

Attachments:

1. Wild Wings site map showing groundwater monitoring wells
2. Example laboratory chain of custody

**CLS LABS**  
**SAMPLE RECEIVING EXCEPTION REPORTS**

CLS Labs Job # 16F1131

Problem discovered by: DD

Date: 4/19/19

Nature of problem

Sulfite

Chlorine, Total

Chlorine, Residual

Ph

Dissolved O<sub>2</sub>

(Circle analysis above) Received out of HOLD time.

---

---

Client contacted? Yes \_\_\_\_\_ No \_\_\_\_\_ Spoke With: \_\_\_\_\_

By whom: \_\_\_\_\_ Date: \_\_\_\_ / \_\_\_\_ / \_\_\_\_ Time: \_\_\_\_ HRS

Client instructions:

---

---

Resolution of problem:

Logged in regardless and will be ran for analysis requested.

---

---



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 2 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-1 (19F1131-01) Water   Sampled: 06/19/19 13:30   Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
<b>Chloride</b>	<b>110</b>	2.5	"	5	1905063	06/20/19	06/20/19	EPA 300.0	
<b>Nitrate as N</b>	<b>9.4</b>	2.0	"	"	"	"	"	"	
<b>Nitrate/Nitrite as N</b>	<b>9.4</b>	2.0	"	"	"	"	06/20/19	"	
Nitrite as N	ND	0.40	"	1	"	"	"	"	
<b>pH</b>	<b>7.44</b>	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
<b>Total Dissolved Solids</b>	<b>1000</b>	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	ND	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
<b>Total Nitrogen</b>	<b>9.5</b>	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	
<b>MW-2 (19F1131-02) Water   Sampled: 06/19/19 14:30   Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
<b>Chloride</b>	<b>110</b>	2.5	"	5	1905063	06/20/19	06/20/19	EPA 300.0	
<b>Nitrate as N</b>	<b>13</b>	2.0	"	"	"	"	"	"	
<b>Nitrate/Nitrite as N</b>	<b>13</b>	2.0	"	"	"	"	06/20/19	"	
Nitrite as N	ND	0.40	"	1	"	"	"	"	
<b>pH</b>	<b>7.47</b>	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
<b>Total Dissolved Solids</b>	<b>1000</b>	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	ND	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
<b>Total Nitrogen</b>	<b>13</b>	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	
<b>MW-3 (19F1131-03) Water   Sampled: 06/19/19 12:30   Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
<b>Chloride</b>	<b>85</b>	2.5	"	5	1905063	06/20/19	06/24/19	EPA 300.0	
<b>Nitrate as N</b>	<b>1.7</b>	0.40	"	1	"	"	06/20/19	"	
<b>Nitrate/Nitrite as N</b>	<b>1.8</b>	0.40	"	"	"	"	"	"	
Nitrite as N	ND	0.40	"	"	"	"	"	"	
<b>pH</b>	<b>7.28</b>	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
<b>Total Dissolved Solids</b>	<b>630</b>	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 3 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings

Project Number: [none]

Project Manager: Dan Demoss

CLS Work Order #: 19F1131

COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-3 (19F1131-03) Water Sampled: 06/19/19 12:30 Received: 06/19/19 16:48</b>									
Total Kjeldahl Nitrogen	<b>0.30</b>	0.20	mg/L	1	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
Total Nitrogen	<b>2.1</b>	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	
<b>MW-4 (19F1131-04) Water Sampled: 06/19/19 12:00 Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
Chloride	<b>230</b>	5.0	"	10	1905063	06/20/19	06/25/19	EPA 300.0	
Nitrate as N	<b>14</b>	2.0	"	5	"	"	06/20/19	"	
Nitrate/Nitrite as N	<b>14</b>	2.0	"	"	"	"	06/20/19	"	
Nitrite as N	ND	0.40	"	1	"	"	"	"	
pH	<b>7.88</b>	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
Total Dissolved Solids	<b>760</b>	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	ND	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
Total Nitrogen	<b>14</b>	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	
<b>MW-5R (19F1131-05) Water Sampled: 06/19/19 14:00 Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
Chloride	<b>52</b>	2.5	"	5	1905063	06/20/19	06/24/19	EPA 300.0	
Nitrate as N	<b>0.56</b>	0.40	"	1	"	"	06/20/19	"	
Nitrate/Nitrite as N	<b>1.4</b>	0.40	"	"	"	"	"	"	
Nitrite as N	<b>0.82</b>	0.40	"	"	"	"	"	"	
pH	<b>7.66</b>	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
Total Dissolved Solids	<b>390</b>	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	<b>0.22</b>	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
Total Nitrogen	<b>1.6</b>	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 4 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-6 (19F1131-06) Water Sampled: 06/19/19 11:30 Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
Chloride	180	2.5	"	5	1905063	06/20/19	06/20/19	EPA 300.0	
Nitrate as N	10	2.0	"	"	"	"	"	"	
Nitrate/Nitrite as N	10	2.0	"	"	"	"	06/20/19	"	
Nitrite as N	ND	0.40	"	1	"	"	"	"	
pH	7.27	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
Total Dissolved Solids	1000	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	ND	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
Total Nitrogen	10	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	
<b>MW-7 (19F1131-07) Water Sampled: 06/19/19 11:00 Received: 06/19/19 16:48</b>									
Ammonia as N	ND	0.10	mg/L	1	1905218	06/25/19	06/25/19	SM4500-NH3F-1997	
Chloride	70	2.5	"	5	1905063	06/20/19	06/24/19	EPA 300.0	
Nitrate as N	3.2	0.40	"	1	"	"	06/20/19	"	
Nitrate/Nitrite as N	3.2	0.40	"	"	"	"	"	"	
Nitrite as N	ND	0.40	"	"	"	"	"	"	
pH	7.36	0.01	pH Units	"	1905089	06/20/19	06/20/19	SM4500-H B	HT-F
Total Dissolved Solids	560	10	mg/L	"	1905095	06/20/19	06/24/19	SM2540C	
Total Kjeldahl Nitrogen	ND	0.20	"	"	1905265	06/26/19	06/26/19	SM4500-NH3F-1997	
Total Nitrogen	3.3	0.40	"	"	1905267	06/26/19	06/26/19	EPA 351.3/300	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 5 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Metals by EPA 200 Series Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-1 (19F1131-01) Water Sampled: 06/19/19 13:30 Received: 06/19/19 16:48</b>									
Boron	5200	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	ND	100	"	"	"	"	"	"	"
Manganese	ND	10	"	"	"	"	"	"	"
Sodium	140000	1000	"	"	"	"	"	"	"
<b>MW-2 (19F1131-02) Water Sampled: 06/19/19 14:30 Received: 06/19/19 16:48</b>									
Boron	5900	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	ND	100	"	"	"	"	"	"	"
Manganese	ND	10	"	"	"	"	"	"	"
Sodium	150000	1000	"	"	"	"	"	"	"
<b>MW-3 (19F1131-03) Water Sampled: 06/19/19 12:30 Received: 06/19/19 16:48</b>									
Boron	1800	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	970	100	"	"	"	"	"	"	"
Manganese	150	10	"	"	"	"	"	"	"
Sodium	120000	1000	"	"	"	"	"	"	"
<b>MW-4 (19F1131-04) Water Sampled: 06/19/19 12:00 Received: 06/19/19 16:48</b>									
Boron	880	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	ND	100	"	"	"	"	"	"	"
Manganese	ND	10	"	"	"	"	"	"	"
Sodium	50000	1000	"	"	"	"	"	"	"
<b>MW-5R (19F1131-05) Water Sampled: 06/19/19 14:00 Received: 06/19/19 16:48</b>									
Boron	310	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	430	100	"	"	"	"	"	"	"
Manganese	ND	10	"	"	"	"	"	"	"
Sodium	59000	1000	"	"	"	"	"	"	"



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 6 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Metals by EPA 200 Series Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-6 (19F1131-06) Water Sampled: 06/19/19 11:30 Received: 06/19/19 16:48</b>									
Boron	4400	50	µg/L	1	1905073	06/20/19	06/21/19	EPA 200.7	
Iron	ND	100	"	"	"	"	"	"	"
Manganese	ND	10	"	"	"	"	"	"	"
Sodium	130000	1000	"	"	"	"	"	"	"
<b>MW-7 (19F1131-07) Water Sampled: 06/19/19 11:00 Received: 06/19/19 16:48</b>									
Boron	1500	50	µg/L	1	1905073	06/20/19	06/20/19	EPA 200.7	
Iron	910	100	"	"	"	"	"	"	"
Manganese	16	10	"	"	"	"	"	"	"
Sodium	86000	1000	"	"	"	"	06/24/19	"	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 7 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Microbiological Parameters by APHA Standard Methods

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-1 (19F1131-01) Water Sampled: 06/19/19 13:30 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	
<b>MW-2 (19F1131-02) Water Sampled: 06/19/19 14:30 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	
<b>MW-3 (19F1131-03) Water Sampled: 06/19/19 12:30 Received: 06/19/19 16:48</b>									
<b>Total Coliforms</b>	<b>33</b>	1.8	MPN/100 mL	1	1905065	06/19/19	06/23/19	SM 9221	
<b>MW-4 (19F1131-04) Water Sampled: 06/19/19 12:00 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	
<b>MW-5R (19F1131-05) Water Sampled: 06/19/19 14:00 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	
<b>MW-6 (19F1131-06) Water Sampled: 06/19/19 11:30 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	
<b>MW-7 (19F1131-07) Water Sampled: 06/19/19 11:00 Received: 06/19/19 16:48</b>									
Total Coliforms	<1.8	1.8	MPN/100 mL	1	1905065	06/19/19	06/21/19	SM 9221	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 8 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings

Project Number: [none]

Project Manager: Dan Demoss

CLS Work Order #: 19F1131

COC #: 201713

### Trihalomethanes by EPA Method 524.2

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-1 (19F1131-01) Water Sampled: 06/19/19 13:30 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
Bromoform	ND	0.50	"	"	"	"	"	"	"
Chloroform	ND	0.50	"	"	"	"	"	"	"
Dibromochloromethane	ND	0.50	"	"	"	"	"	"	"
Total Trihalomethanes (THM)	ND	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		103 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		94 %	70-130		"	"	"	"	"
<b>MW-2 (19F1131-02) Water Sampled: 06/19/19 14:30 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
<b>Bromoform</b>	<b>6.1</b>	0.50	"	"	"	"	"	"	"
<b>Chloroform</b>	<b>1.3</b>	0.50	"	"	"	"	"	"	"
<b>Dibromochloromethane</b>	<b>1.8</b>	0.50	"	"	"	"	"	"	"
<b>Total Trihalomethanes (THM)</b>	<b>9.6</b>	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		106 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		92 %	70-130		"	"	"	"	"
<b>MW-3 (19F1131-03) Water Sampled: 06/19/19 12:30 Received: 06/19/19 16:48</b>									
<b>Bromodichloromethane</b>	<b>1.2</b>	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
Bromoform	ND	0.50	"	"	"	"	"	"	"
<b>Chloroform</b>	<b>7.2</b>	0.50	"	"	"	"	"	"	"
<b>Dibromochloromethane</b>	<b>0.74</b>	0.50	"	"	"	"	"	"	"
<b>Total Trihalomethanes (THM)</b>	<b>9.1</b>	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		103 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		94 %	70-130		"	"	"	"	"



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 9 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Trihalomethanes by EPA Method 524.2

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-4 (19F1131-04) Water Sampled: 06/19/19 12:00 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
<b>Bromoform</b>	<b>3.1</b>	0.50	"	"	"	"	"	"	"
Chloroform	ND	0.50	"	"	"	"	"	"	"
<b>Dibromochloromethane</b>	<b>0.64</b>	0.50	"	"	"	"	"	"	"
<b>Total Trihalomethanes (THM)</b>	<b>4.1</b>	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		105 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		81 %	70-130		"	"	"	"	"
<b>MW-5R (19F1131-05) Water Sampled: 06/19/19 14:00 Received: 06/19/19 16:48</b>									
<b>Bromodichloromethane</b>	<b>12</b>	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
Bromoform	ND	0.50	"	"	"	"	"	"	"
<b>Chloroform</b>	<b>270</b>	5.0	"	10	"	"	"	"	"
<b>Dibromochloromethane</b>	<b>0.55</b>	0.50	"	1	"	"	"	"	"
<b>Total Trihalomethanes (THM)</b>	<b>280</b>	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		93 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		95 %	70-130		"	"	"	"	"
<b>MW-6 (19F1131-06) Water Sampled: 06/19/19 11:30 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
<b>Bromoform</b>	<b>2.4</b>	0.50	"	"	"	"	"	"	"
Chloroform	<b>6.3</b>	0.50	"	"	"	"	"	"	"
<b>Dibromochloromethane</b>	<b>0.76</b>	0.50	"	"	"	"	"	"	"
<b>Total Trihalomethanes (THM)</b>	<b>9.8</b>	0.50	"	"	"	"	"	"	"
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		101 %	70-130		"	"	"	"	"
<i>Surrogate: Toluene-d8</i>									
		85 %	70-130		"	"	"	"	"



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 10 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Trihalomethanes by EPA Method 524.2

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
<b>MW-7 (19F1131-07) Water Sampled: 06/19/19 11:00 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
Bromoform	ND	0.50	"	"	"	"	"	"	
Chloroform	ND	0.50	"	"	"	"	"	"	
<b>Dibromochloromethane</b>	<b>0.73</b>	0.50	"	"	"	"	"	"	
<b>Total Trihalomethanes (THM)</b>	<b>1.3</b>	0.50	"	"	"	"	"	"	
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		104 %	70-130	"	"	"	"	"	
<i>Surrogate: Toluene-d8</i>									
		94 %	70-130	"	"	"	"	"	
<b>Trip Blank (19F1131-08) Water Sampled: 06/19/19 10:00 Received: 06/19/19 16:48</b>									
Bromodichloromethane	ND	0.50	µg/L	1	1905131	06/20/19	06/20/19	EPA 524.2	
Bromoform	ND	0.50	"	"	"	"	"	"	
Chloroform	ND	0.50	"	"	"	"	"	"	
Dibromochloromethane	ND	0.50	"	"	"	"	"	"	
Total Trihalomethanes (THM)	ND	0.50	"	"	"	"	"	"	
<i>Surrogate: 1,2-Dichloroethane-d4</i>									
		105 %	70-130	"	"	"	"	"	
<i>Surrogate: Toluene-d8</i>									
		92 %	70-130	"	"	"	"	"	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 11 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC %REC	Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	-----------	--------	---------	-----------	-------

#### Batch 1905063 - General Prep

##### Blank (1905063-BLK1)

Prepared: 06/20/19 Analyzed: 06/25/19

Chloride	ND	0.50	mg/L							
Nitrate as N	ND	0.40	"							
Nitrite as N	ND	0.40	"							
Nitrate/Nitrite as N	ND	0.40	"							

##### LCS (1905063-BS1)

Prepared & Analyzed: 06/20/19

Chloride	4.55	0.50	mg/L	5.00		91	80-120			
Nitrite as N	1.90	0.40	"	2.00		95	80-120			
Nitrate as N	1.83	0.40	"	2.00		92	80-120			
Nitrate/Nitrite as N	3.73	0.40	"	4.00		93	80-120			

##### LCS Dup (1905063-BSD1)

Prepared & Analyzed: 06/20/19

Chloride	4.62	0.50	mg/L	5.00		92	80-120	1	20	
Nitrate/Nitrite as N	3.75	0.40	"	4.00		94	80-120	0.4	20	
Nitrate as N	1.84	0.40	"	2.00		92	80-120	0.4	20	
Nitrite as N	1.91	0.40	"	2.00		95	80-120	0.5	20	

##### Matrix Spike (1905063-MS1)

##### Source: 19F1097-01

Prepared & Analyzed: 06/20/19

Chloride	89.7	0.50	mg/L	5.00	91.4	NR	80-120			QM-4X
Nitrate/Nitrite as N	13.5	0.40	"	4.00	10.9	67	80-120			QM-7
Nitrate as N	11.9	0.40	"	2.00	10.9	52	80-120			QM-7
Nitrite as N	1.63	0.40	"	2.00	ND	81	80-120			

##### Matrix Spike Dup (1905063-MSD1)

##### Source: 19F1097-01

Prepared & Analyzed: 06/20/19

Chloride	89.7	0.50	mg/L	5.00	91.4	NR	80-120	0.09	20	QM-4X
Nitrate as N	11.8	0.40	"	2.00	10.9	49	80-120	0.6	20	QM-7
Nitrite as N	1.65	0.40	"	2.00	ND	83	80-120	2	20	
Nitrate/Nitrite as N	13.5	0.40	"	4.00	10.9	66	80-120	0.3	20	QM-7



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 12 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC %REC	Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	-----------	--------	---------	-----------	-------

#### Batch 1905089 - General Preparation

Duplicate (1905089-DUP1)                          Source: 19F1123-02                          Prepared & Analyzed: 06/20/19

pH	ND	0.01	pH Units	7.88	20
----	----	------	----------	------	----

#### Batch 1905095 - General Preparation

Blank (1905095-BLK1)                                  Prepared: 06/20/19 Analyzed: 06/24/19

Total Dissolved Solids	ND	10	mg/L
------------------------	----	----	------

Duplicate (1905095-DUP1)                                  Source: 19F1026-06                          Prepared: 06/20/19 Analyzed: 06/24/19

Total Dissolved Solids	369	10	mg/L	363	2	20
------------------------	-----	----	------	-----	---	----

#### Batch 1905218 - General Preparation

Blank (1905218-BLK1)                                  Prepared & Analyzed: 06/25/19

Ammonia as N	ND	0.10	mg/L
--------------	----	------	------

LCS (1905218-BS1)    Prepared & Analyzed: 06/25/19

Ammonia as N	0.445	0.10	mg/L	0.500	89	80-120
--------------	-------	------	------	-------	----	--------

LCS Dup (1905218-BSD1)                                  Prepared & Analyzed: 06/25/19

Ammonia as N	0.435	0.10	mg/L	0.500	87	80-120	2	25
--------------	-------	------	------	-------	----	--------	---	----

Matrix Spike (1905218-MS1)                                  Source: 19F1031-03                          Prepared & Analyzed: 06/25/19

Ammonia as N	0.482	0.10	mg/L	0.500	0.0850	79	75-125
--------------	-------	------	------	-------	--------	----	--------

Matrix Spike Dup (1905218-MSD1)                                  Source: 19F1031-03                          Prepared & Analyzed: 06/25/19

Ammonia as N	0.466	0.10	mg/L	0.500	0.0850	76	75-125	3	25
--------------	-------	------	------	-------	--------	----	--------	---	----



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 13 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Conventional Chemistry Parameters by APHA/EPA Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

#### Batch 1905265 - General Preparation

<b>Blank (1905265-BLK1)</b>										Prepared & Analyzed: 06/26/19
Total Kjeldahl Nitrogen	ND	0.20	mg/L							
<b>LCS (1905265-BS1)</b>										
Total Kjeldahl Nitrogen	0.509	0.20	mg/L	0.500		102	80-120			
<b>LCS Dup (1905265-BSD1)</b>										
Total Kjeldahl Nitrogen	0.513	0.20	mg/L	0.500		103	80-120	0.8	20	
<b>Matrix Spike (1905265-MS1)</b>				<b>Source: 19F1307-04</b>						Prepared & Analyzed: 06/26/19
Total Kjeldahl Nitrogen	1.03	0.20	mg/L	0.500	0.540	98	75-125			
<b>Matrix Spike Dup (1905265-MSD1)</b>				<b>Source: 19F1307-04</b>						Prepared & Analyzed: 06/26/19
Total Kjeldahl Nitrogen	1.03	0.20	mg/L	0.500	0.540	97	75-125	0.2	25	



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 14 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Metals by EPA 200 Series Methods - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

#### Batch 1905073 - EPA 200 Series

Blank (1905073-BLK1)		Prepared & Analyzed: 06/20/19					
Boron	ND	50	µg/L				
Iron	ND	100	"				
Manganese	ND	10	"				
Sodium	ND	1000	"				

LCS (1905073-BS1)		Prepared & Analyzed: 06/20/19					
Boron	973	50	µg/L	1000	97	85-115	
Iron	954	100	"	1000	95	85-115	
Manganese	972	10	"	1000	97	85-115	
Sodium	4230	1000	"	5000	85	85-115	

Matrix Spike (1905073-MS1)		Source: 19F1131-07		Prepared & Analyzed: 06/20/19				
Boron	1010	50	µg/L	1000	1490	NR	70-130	QM-7
Iron	1090	100	"	1000	907	18	70-130	QM-7
Manganese	1370	10	"	1000	16.1	135	70-130	QM-7
Sodium	8180	1000	"	5000	86400	NR	70-130	QM-7

Matrix Spike (1905073-MS2)		Source: 19F1109-01		Prepared & Analyzed: 06/20/19				
Boron	2360	50	µg/L	1000	14.9	235	70-130	QM-7
Iron	1750	100	"	1000	134	162	70-130	QM-7
Manganese	913	10	"	1000	398	52	70-130	QM-7
Sodium	72000	1000	"	5000	3940	NR	70-130	QM-7



## CALIFORNIA LABORATORY SERVICES

Committed. Responsive. Flexible.

Page 15 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

CLS Work Order #: 19F1131  
COC #: 201713

### Trihalomethanes by EPA Method 524.2 - Quality Control

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	---------	-----------	-------

#### Batch 1905131 - EPA 5030 Water MS

##### Blank (1905131-BLK1)

Prepared: 06/08/19 Analyzed: 06/20/19

Bromodichloromethane	ND	0.50	µg/L							
Bromoform	ND	0.50	"							
Chloroform	ND	0.50	"							
Dibromochloromethane	ND	0.50	"							
Total Trihalomethanes (THM)	ND	0.50	"							
<i>Surrogate: 1,2-Dichloroethane-d4</i>	10.2		"	10.0		102	70-130			
<i>Surrogate: Toluene-d8</i>	9.43		"	10.0		94	70-130			

##### LCS (1905131-BS1)

Prepared: 06/08/19 Analyzed: 06/20/19

Bromodichloromethane	20.7	0.50	µg/L	20.0		103	70-130			
Bromoform	22.0	0.50	"	20.0		110	70-130			
Chloroform	18.7	0.50	"	20.0		94	70-130			
Dibromochloromethane	21.4	0.50	"	20.0		107	70-130			
<i>Surrogate: 1,2-Dichloroethane-d4</i>	8.41		"	10.0		84	70-130			
<i>Surrogate: Toluene-d8</i>	10.3		"	10.0		103	70-130			

##### LCS Dup (1905131-BSD1)

Prepared: 06/08/19 Analyzed: 06/20/19

Bromodichloromethane	20.4	0.50	µg/L	20.0		102	70-130	2	30	
Bromoform	22.6	0.50	"	20.0		113	70-130	3	30	
Chloroform	18.1	0.50	"	20.0		90	70-130	3	30	
Dibromochloromethane	21.3	0.50	"	20.0		107	70-130	0.1	30	
<i>Surrogate: 1,2-Dichloroethane-d4</i>	8.53		"	10.0		85	70-130			
<i>Surrogate: Toluene-d8</i>	10.2		"	10.0		102	70-130			



CALIFORNIA LABORATORY SERVICES

*Committed. Responsive. Flexible.*

Page 16 of 16

06/26/19 16:11

California Rural Water Association  
1234 N. Market Blvd.  
Sacramento, CA 95834

Project: Wild Wings  
Project Number: [none]  
Project Manager: Dan Demoss

**CLS Work Order #: 19F1131**  
COC #: 201713

#### Notes and Definitions

QM-7 The spike recovery was outside acceptance limits for the MS and/or MSD. The batch was accepted based on acceptable LCS and/or LCSD recovery.

QM-4X The spike recovery was outside of QC acceptance limits for the MS and/or MSD due to analyte concentration at 4 times or greater than the spike concentration. The QC batch was accepted based on LCS and/or LCSD recoveries within the acceptance limits.

HT-F This is a field test method and it is performed in the lab outside holding time.

BT-4 <1.8

DET Analyte DETECTED

ND Analyte NOT DETECTED at or above the reporting limit (or method detection limit when specified)

NR Not Reported

dry Sample results reported on a dry weight basis

RPD Relative Percent Difference